USER'S GUIDE

Installation & Operation Instructions

Open Channel Flow Monitor *Model OCF 5.0* Manual Series A.1.1 Note: This page has been left blank intentionally.



INDEX

CONNECTIONS:	4
KEYPAD SYSTEM	6
CALIBRATION MENU	7
RUN	8
MESSAGE	8
STATUS	8
PASSWORD	9
UNITS/MODE	10
CALIBRATION	11
CHANNEL SETUP	14
RELAY PARAMETERS	15
DATA LOGGING	16
SPECIAL FUNCTIONS	18
SENSOR MOUNTING/LOCATION	20
APPLICATIONS HOTLINE	24
PRODUCT RETURN PROCEDURE	25
APPENDIX A - OPTIONS	27
CONVERSION GUIDE	31
SPECIFICATIONS	32

IMPORTANT NOTE: This instrument is manufactured and calibrated to meet product specifications. Please read this manual carefully before installation and operation. Any unauthorized repairs or modifications may result in a suspension of the warranty.

Available in Adobe Acrobat pdf format



CONNECTIONS:

POWER INPUT: The standard model requires AC power input between 100 to 240 VAC 50/60Hz. No adjustments are necessary for voltages within this range.

Optional DC: 9-32 VDC. Connect to + and - terminals.

Optional Thermostat and Heater modules are available rated for 115 VAC or 230 VAC.

IMPORTANT NOTE: To comply with CSA/UL electrical safety standards, AC power input and relay connection wires must have conduit entry to the instrument enclosure. Installation requires a switch, overcurrent fuse or circuit breaker in the building (in close proximity to the equipment) that is marked as the disconnect switch.




Risk of electric shock. Loosen cover screw to access connections. Only qualified personnel should access connections.

Note: Use of instrumentation over 40°C ambient requires special field wiring.

Note: User replaceable fuse is 2 Amp 250V (T2AL250V).



CONNECTIONS

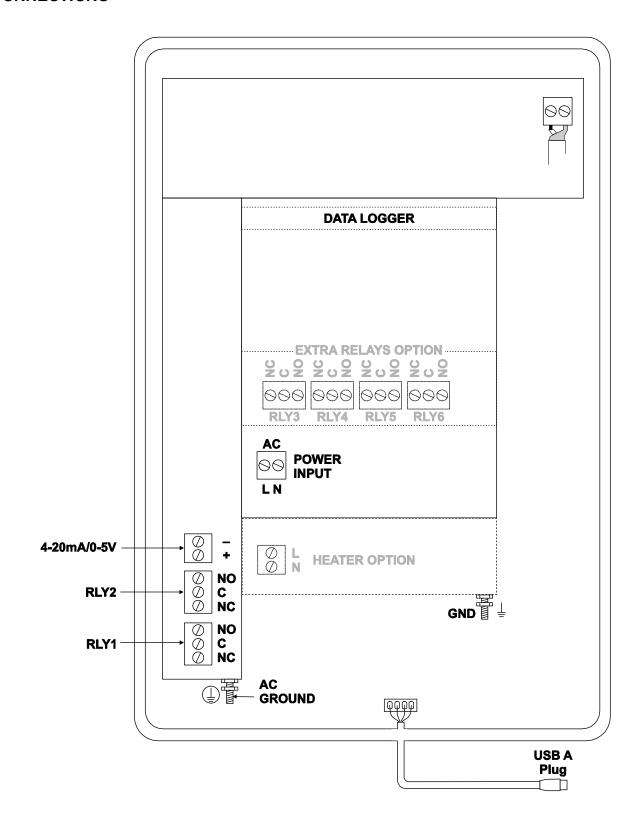




KEYPAD SYSTEM


The OCF 5.0 uses a menu system. Arrows show the four directions to leave a menu box. Press a key to move to the next item in the direction shown. Move the cursor (underline) under numerals and increase or decrease numerals with the \clubsuit and \clubsuit keys.

To store calibration values permanently (even through power interruptions), press ✓.

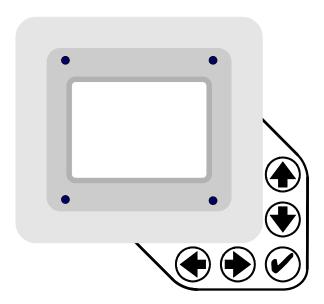



CALIBRATION MENU

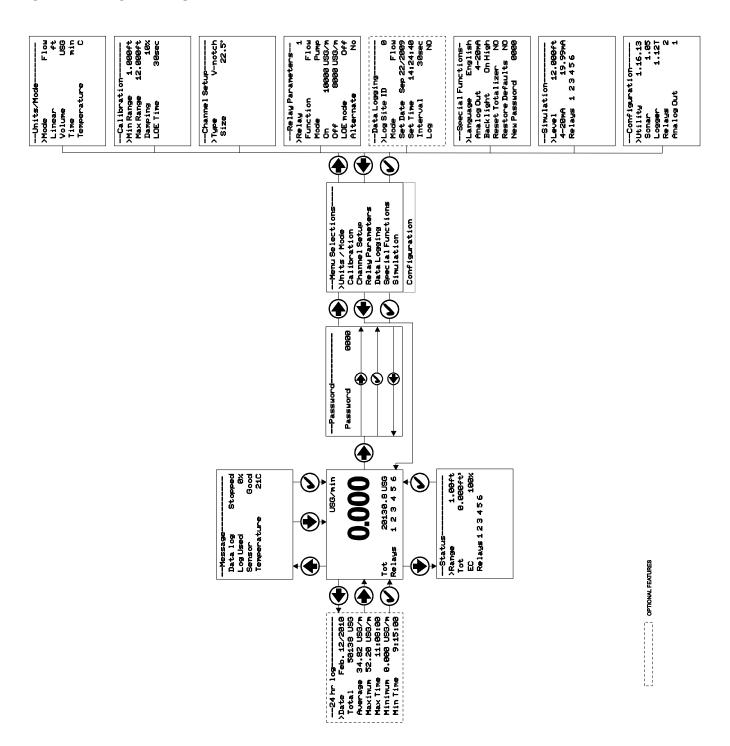



USG/min

0.000

Tot 20130.8USG Relays 1 2 3 4 5 6

--Message-----Data log Stopped
Log Used 0%
Sensor Good
Temperature 21C

--Status------>Range 1.00ft Tot 0.000ft³ EC 100% Relays 1 2 3 4 5 6

RUN

The main display shows the units selected from the Units/Mode menu, Level, Range, Flow, HRT, and Volume rate being measured, TOTALIZER and RELAY states. The OCF 5.0 will start-up with this display and will return to this screen after a timeout if keys are not pressed in other menus.

MESSAGE

Press ♠ from the RUN display to view status of the data logger and error/warning messages provided by the instrument. The word Message will appear on the RUN display if error messages are being generated by the instrument. Refer to the manual section Error/Warning Messages for a description. Press ✓ to return to the main display.

STATUS

Press ♣ from the RUN display to view instrument status. Range will be displayed in linear units.

Tot Displays the current totalizer reading.


EC Displays echo confidence.

Relays Energized relays will display as a white character on a black


background.

24 HR LOG

Press ← from the RUN display to view a formatted flow report from instruments with a built-in data logger. Press to scroll down one day or repeatedly to scroll to a specific date. Up to 365 days can be stored. Newest date will overwrite the oldest. Press to return to the main display.





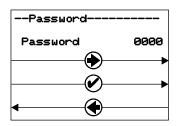

PASSWORD

The Password (a number from 0000 to 9999) prevents unauthorized access to the Calibration menu.

From the Run display press to get to Password. Factory default password is 0000 and if it has not been changed press the \checkmark to proceed to the Menu Selections screen.

If a password is required, press → to place the cursor under the first digit and ↓ or ♠ to set the number, then → to the second digit, etc. Press → or ✓ to proceed to the Menu Selections screen.


A new password can be stored by going to Special Functions/New Password.



Units/Mode	
>Mode	Flow
Linear	ft
Volume	USG
Time	min
Temperature	C

Units/Mode-	
Mode	Flow
>Linear	i <u>n</u>
	ft
	m
	TATA

Units/Mode	
>Volume	US <u>G</u> ft3 bb1 L m3 IMG IG USMG

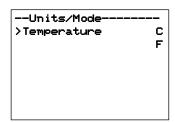

UNITS/MODE

From >Mode press the → and then the ↑ or ↓ to select Level, Range, Flow, HRT or Volume.

displays distance from the sensor to the target or liquid surface like a tape measure. Range mode is useful to measure the exact distance from the sensor to the zero level during calibration.

Le∪e1 used to measure tank level in linear units, or "Head" in an open channel for comparison with flow tables.

Volume displays tank inventory in engineering units.

HRT select Horizontal Round Tank mode to calculate and display volume

units in a horizontal round tank.

Flow calculates open channel flow through a flume or weir.

Volume, HRT or Flow gives the additional choice of volumetric units:

ft3 - cubic feet USG - US gallons

USMG - US million gallons (FLOW only)

IG - Imperial gallons

IMG - Imperial million gallons (FLOW only)

m3 - cubic meters

L - liters

bbl - U.S. oil barrel


Press \checkmark to store the selection, then \blacktriangledown to the next menu item and \Longrightarrow to enter.

Linear press → and then ↑ or ↓ to select units of measurement.

Press ✓ to store the selection.

Temperature press → then ↑ to select C or F (Centigrade or Fahrenheit).

Press ← or ✓ to return to the Menu Selections screen.





--Calibration----->Min Range 1.000ft
Max Range 12.000ft
Damping 10%
LOE Time 30sec

CALIBRATION

Press ♣ to Calibration and ➡ to enter. Use ♣ or ♠ to position > before each menu item and ➡ to enter. When settings are completed press ✓ to store and return to the Calibration menu.

MaxVol For Volume and HRT mode only. Enter the maximum volume of the vertical or horizontal tank.


Minimum damping allows fast response to level changes. Increasing damping slows the OCF 5.0's response to level changes and is ideal to smooth the display and outputs in turbulent conditions. Damping value is shown in percent (0-99%). Some experimentation may be required to select the optimum damping value. A value of 1% is recommended for most applications and for fast level changes (up to ½ inch/sec - 13 mm/sec).

LOE Time Press → and ↑ or ↓ to change the number of seconds without receiving an echo before the OCF 5.0 displays ECHO LOSS, and Control relays change state as calibrated under Relay Parameters.


Factory default is 30 seconds and is recommended for most applications, Minimum is 1 second and maximum is 99 seconds.

Press ✓ from the Units/Mode display to return to Menu Selections.



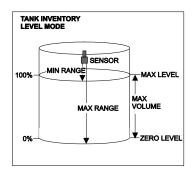

TANK INVENTORY RANGE MODE SENSOR MIN RANGE MAX LEVEL MAX RANGE 100% ZERO LEVEL

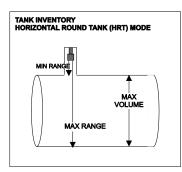

CALIBRATION

- for Level/Inventory Applications

1. Before starting the calibration determine:

a) MAX RANGE = _____ (Maximum range = distance from Sensor to Zero level)

b) MAX LEVEL = _____ (Maximum level of product being measured)

c) MIN RANGE = _____ (Distance from sensor to Max Level) Minimum range = MAX RANGE - MAX LEVEL (must be at least 8" / 203 mm depending on sensor model)

- 2. Check the maximum range with the sensor installed:
- a) When liquid is at zero level press ♣ to view the Range reading in the Status menu. Use this range measured by the OCF 5.0 as the Max Range setting.

 or
- b) Carefully measure distance from sensor to zero level with a tape measure, and use this measurement as the Max Range setting.

MINIMUM RANGE:

In the CAL IBRATION menu

- Press ♥ to get to Min Range
- Press → to move the cursor under the digits
- Use **♣** or **♠** to set the minimum range


Note: Min Range must be at least 12" (30.5 cm) for PZ32T sensors, 16" (40.6 cm) for PZ52T and PZ34 sensors and 8" for PZ15 sensors. For correct tank volume calculation in Hrt mode Min Range must be the actual distance from the end of the sensor to the top of the tank.

MAXIMUM RANGE:

Press

to get to Max Range
Enter Max Range determined above.



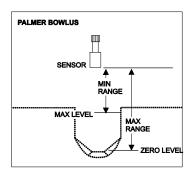


CALIBRATION

- for Open Channel Flow
- 1. Before starting the calibration determine:

a) MAX RANGE = _____ (Maximum range = distance from the Sensor to Zero flow point)


b) MAX LEVEL = ______ (Maximum level of flow through flume or weir)

c) MIN RANGE = ______
(Distance from sensor to Max Level)
Minimum range = MAX RANGE - MAX LEVEL
(must be at least 8" / 20.3 cm depending on sensor model).



- a) When liquid is at zero level press ◆ to view the Range reading in the Status menu. Use this range measured by the OCF 5.0 as the Max Range setting.
- b) Carefully measure distance from sensor to zero level with a tape measure, and use this measurement as the Max Range setting.

NOTE: The OCF 5.0 will not detect targets beyond user entered Max Range.

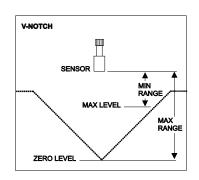



CHANNEL SETUP

Channel Setup					
>Type	V-notch				
Size	22.5°				
	120°				
	90°				
	60°				
	45°				
	30°				

--Channel Setup---->Type Custom
K 0.0000
n 0.0000

--Channel Setup-----> >Type Khafagi Height 0.000ft

Chann	el Se	tup
>Type	RECT	Weir w∕EC
Height		0.000ft

--Channel Setup---->Type RECT Weir Height 0.000ft --Channel Setup---->Type Trapezoidal
Size Extra large 60°
Large 60°
Small 60°
12in 45° SRCRC
2in 45° WSC
8in 60°

Channel Setup					
>Type	Leopld-Lagco				
Size	36in				
	30in				
	24 i n				
	18 in				
	12 in				
	10 in				
	8in				
	6in				

--Channel Setup---->Tupe Palmer Bowlus
Size 48in
42in
36in
30in
27in
24in
21in
18in
15in
12in
10in
8in
6in
4in

--Channel Setup---->Type Parshall
Size 12ft
10ft
8ft
6ft
5ft
4ft
3ft
18in
12in
6in
3in
2in





--Relay Parameters-->Relay Function Mode On 0ff LOE mode

1 Flow Pump 10000 USG/m 8000 USG/m Off Alternate NO

--Relay Parameters-->Relay 1 Function Temperature Oπ 0.0C Off 9.0C

--Relay Parameters-->Relau Function Pulse 10.000ft3 Oπ

--Relay Parameters-->Relay 1 Function Leve 1 Mode Pump 12.000ft On Off 3.000ft LOE mode Off Alternate NO RELAY PARAMETERS

Relau Press \Rightarrow and \blacksquare or \spadesuit to select a relay (2 relays are standard, 4

additional are optional).

Press ♥ or ★ to select Off, Temperature, Pulse and Function

Level.

Temperature Air temperature at the sensor location. Press ♥ and • and set

the relay On and Off for specific temperatures.

Press ♣ and set digits to the flow volume increment required Pulse

> between relay pulses. Use this feature for remote samplers, chlorinators or totalizers. Minimum time between pulses is

2.25 seconds and pulse duration is 350 milliseconds.

Level Level, Range, Volume or HRT modes only. Press ♥ to

R Function and → to select Pump, LoAlm (low alarm)

or HiAlm (high alarm).

Press ✓ to return to Menu Selections.



Data Log	ging
>Log Site	
	99
Mode	Leve l
	Range
	Flow
	HRT
	Volume
Set Date	Feb 18/2008 Mar 19/2009
C-4 T:	
Set Time	11:27:40 12:28:41
Interval	10sec
	60min
	3 <u>0</u> min
	10min
	5min 2min
	2min 1min
	30sec
Log	Start
L09	Stop
	Delete
1	

DATA LOGGING

Setup

Select Data Logging from Menu Selections.

Log Site ID Enter a number from 00 to 99. The site ID will become

part of the downloaded file name to help distinguish downloads from different instruments. Press ✓ to store the

setting.

Mode Select Level, Range, Flow, HRT and Volume.

Flow (e.g. USGPM or l/sec). Press ✓ to store the setting.

Set Date Press ★ or ▼ to scroll and select Month, Day and Year.

Press \checkmark to store the setting.

Set Time Press ★ or ▼ to select the current time in Hours, Minutes

and Seconds. Press ✓ to store the setting.

Interval Press o or ■ to select the logging interval. Flow rate

reading will be stored at each time interval. Press ✓ to

store the setting.

Note: Press \blacksquare to Log \Rightarrow and \spadesuit or \blacksquare to Delete and \checkmark to delete the log file. Press \Rightarrow and \spadesuit or \blacksquare to Start and \checkmark to

restart the logger.

Log Stop, Start or Delete the log file. Delete old file

and start a new log to apply any changes that have been made to the Log Site ID, Mode or Interval.


RETRIEVE LOG FILE

Plug a USB Flash Memory Drive (not supplied by Greyline) into the USB output cable from the instrument. The instrument display will show the message Downloading until the log file is transferred to the memory card and then display Completed. The USB flash drive may be removed.

Download file names will appear in this format:



Tag is set according to the Log Site ID entered in the instrument Data Logging menu.





Download letter will be A for the first download from an instrument. B for the second, then C etc. At the letter Z a - character will appear indicating that the maximum number of downloads for that instrument are on the USB flash drive. Older files can be erased or moved from the flash memory drive or a new memory drive can be used.

OPENING LOG FILES

Install Greyline Logger on your PC or laptop. Refer to the Help menu in the program for detailed instructions.

Select File/Open/Instrument Log (.log) to open the log file from your USB flash drive





--Special Functions->Language English Analog Out 4-20mA Backlight On High Reset Totalizer NO Restore Defaults NO New Password 0000

--Special Functions-Language English >Backlight On High On Med On Low Key Hizho Key High Key Med Key Low Off

SPECIAL FUNCTIONS

Language Select English, French or Spanish and press

✓.

Analog Out Select 4-20mA or 0-5V mode for the analog output.

Backlight Select On High, Medium or Low for continuous

backlight.

Select Key Hi/Lo for high backlight (for 1 minute) after a keypress and then Lo backlight until a key is

pressed again.

Select Key High, Med or Low for backlight after a keypress and then backlight off until a key is pressed

again.

Reset Totalizer Press → and select Yes to erase and restart the

totalizer at zero.

Restore Defaults Select Yes and press ✓ to erase all user settings and


return the instrument to factory default settings

New Password Select any number from 0000 to 9999 and press ✓.

Default setting of 0000 will allow direct access to the calibration menus. Setting of any password greater than 0000 will require the password to be entered to

access the calibration menus.

Press ✓ to return to Menu Selections.





--Simulation----->Level 9.981ft 4-20mA 18.52mA Relays 1 2 3 4 5 6

SIMULATION

Exercises the 4-20mA output, digital display and control relays.

Press \Rightarrow and then \clubsuit or \spadesuit to change the simulated output. Press \checkmark to begin simulation. The 4-20mA value and relay states will be displayed.


Press the ✓ to terminate simulation and return to the Menu Selections screen.




SENSOR MOUNTING/LOCATION - Tank Level/Inventory Applications

Each OCF 5.0 Level Transmitter includes a noncontacting ultrasonic sensor. The sensor must be installed in a position to obtain unobstructed echoes from the liquid or material being measured.

Mount the sensor away from pipes, ladders, or structural members which might cause continuous false echoes.

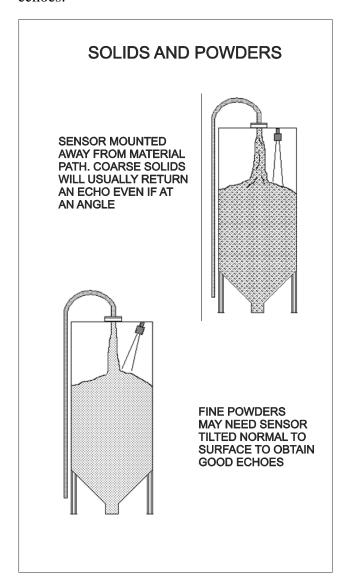


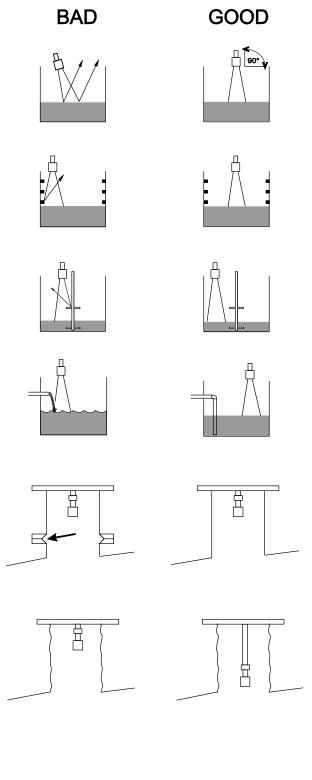



SENSOR MOUNTING LOCATION

- Tank Level/Inventory Applications

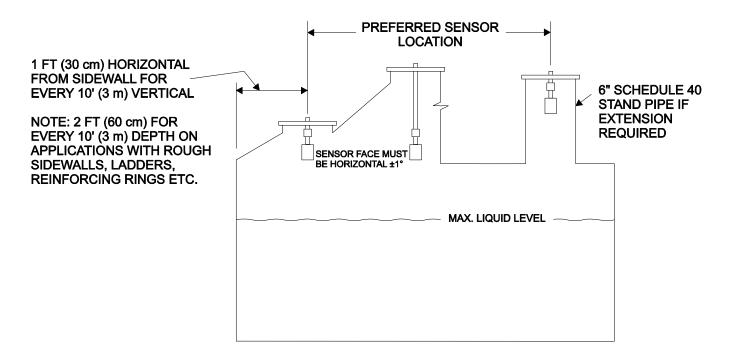

SENSOR MOUNTING

Each sensor is equipped with a ¾ inch "isolation coupling" which MUST be used in your installation. A threaded nipple or length of conduit may be used to position the sensor at the desired height.

The sensor should be hand-tightened (like a light bulb) by turning the sensor stem only. DO NOT use a wrench and do not over tighten. DO NOT clamp the sensor below the isolation coupling.



ENCLOSURE INSTALLATION

Locate the enclosure within 20 ft (6 m) of the sensor (500 ft -150 m optional). The enclosure can be wall mounted with the four mounting screws (included) or panel mounted with Option PM Panel Mount kit from Greyline Instruments.


Avoid mounting the enclosure in direct sunlight to protect the electronics from damage due to overheating and condensate. In high humidity atmospheres, or where temperatures fall below freezing, Option TH Enclosure Heater and Thermostat is recommended. Seal conduit entries to prevent moisture from entering enclosure.

NEMA4X (IP66) WITH CLEAR COVER

- 1. Open hinged enclosure cover.
- 2. Insert #8 screws (supplied) through the four enclosure mounting holes to secure the enclosure to the wall or mounting stand.

Additional conduit holes can be cut in the bottom of the enclosure when required. Use a hole saw or Greenlee-type hole cutter to cut the required holes.

DO NOT make conduit/wiring entries into the top of the enclosure.

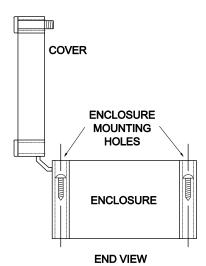

Note: This non-metallic enclosure does not automatically provide grounding between conduit connections. Grounding must be provided as part of the installation. Ground in accordance with the requirements of the National Electrical Code. System grounding is provided by connecting grounding wires from all conduit entries to the steel mounting plate or another point which provides continuity.

CLEANING

Cleaning is not required as a part of normal maintenance.



PZxx Series Sensors

Troubleshooting

Resistance measured (between the shield and centre wire) across the coaxial cable ends by mulitmeter indicates ambient temperature.

Resistance vs. Temperature

	Values are in Ohms									
Temp °C	+0	+1	+2	+3	+4	+5	+6	+7	+8	+9
0	10000.0	10039.0772	10078.1429	10117.1970	10156.2396	10195.2706	10234.2901	10273.2980	10312.2944	10351.2792
10	10390.2525	10429.2142	10468.1644	10507.1030	10546.0301	10584.9456	10623.8496	10662.7420	10701.6229	10740.4922
20	10779.3500	10818.1962	10857.0309	10895.8540	10934.6656	10973.4656	11012.2541	11051.0310	11089.7964	11128.5502
30	11167.2925	11206.0232	11244.7424	11283.4500	11322.1461	11360.8306	11399.5036	11438.1650	11476.8149	11515.4532
40	11554.0800	11592.6952	11631.2989	11669.8910	11708.4716	11747.0406	11785.5981	11824.1440	11862.6784	11901.2012
50	11939.7125									

^{© 2009} Minco, All Rights Reserved

Values are in Ohms										
Temp °F	+0	+1	+2	+3	+4	+5	+6	+7	+8	+9
30			10000.0	10021.7110	10043.4184	10065.1223	10086.8226	10108.5193	10130.2125	10151.902
40	10173.5881	10195.2706	10216.9495	10238.6249	10260.2967	10281.9649	10303.6295	10325.2906	10346.9481	10368.602
50	10390.2525	10411.8993	10433.5426	10455.1823	10476.8184	10498.4510	10520.0800	10541.7054	10563.3273	10584.945
60	10606.5604	10628.1716	10649.7792	10671.3832	10692.9837	10714.5806	10736.1740	10757.7638	10779.3500	10800.932
70	10822.5118	10844.0873	10865.6593	10887.2277	10908.7925	10930.3538	10951.9115	10973.4656	10995.0162	11016.563
80	11038.1067	11059.6466	11081.1829	11102.7156	11124.2448	11145.7704	11167.2925	11188.8110	11210.3259	11231.837
90	11253.3451	11274.8493	11296.3500	11317.8471	11339.3406	11360.8306	11382.3170	11403.7999	11425.2792	11446.754
100	11468.2270	11489.6956	11511.1606	11532.6221	11554.0800	11575.5343	11596.9851	11618.4323	11639.8759	11661.316
110	11682.7525	11704.1854	11725.6148	11747.0406	11768.4629	11789.8816	11811.2967	11832.7082	11854.1162	11875.520
120	11896.9215	11918.3188	11939.7125							

© 2009 Minco, All Rights Reserved



APPLICATIONS HOTLINE

For applications assistance, advice or information on any Greyline Instrument contact your Sales Representative, write to Greyline or phone the Applications Hotline below:

United States: Tel: 315-788-9500 Fax: 315-764-0419 Canada: Tel: 613-938-8956 Fax: 613-938-4857

Toll Free: 888-473-9546
Email: info@greyline.com
Web Site: www.greyline.com

Greyline Instruments Inc.

Canada USA:

16456 Sixsmith Drive 105 Water Street Long Sault, Ont. K0C 1P0 Massena, NY 13662



PRODUCT RETURN PROCEDURE

Instruments may be returned to Greyline for service or warranty repair.

1) Obtain an RMA Number from Greyline -

Before shipping a product to the factory please contact Greyline by telephone, fax or email to obtain an RMA number (Returned Merchandise Authorization). This ensures fast service and correct billing or credit.

When you contact Greyline please have the following information available:

- 1. Model number / Software Version
- 2. Serial number
- 3. Date of Purchase
- 4. Reason for return (description of fault or modification required)
- 5. Your name, company name, address and phone number

2) Clean the Sensor/Product -

Important: unclean products will not be serviced and will be returned to the sender at their expense.

- 1. Rinse sensor and cable to remove debris.
- 2. If the sensor has been exposed to sewage, immerse both sensor and cable in a solution of 1 part household bleach (Javex, Clorox etc.) to 20 parts water for 5 minutes. Important: do not immerse open end of sensor cable.
- 3. Dry with paper towels and pack sensor and cable in a sealed plastic bag.
- 4. Wipe the outside of the enclosure to remove dirt or deposits.
- 5. Return to Greyline for service.
- 3) Ship to Greyline -

After obtaining an RMA number please ship the product to the appropriate address below:

Canadian and International USA
Customers: Customers:

Greyline Instruments Inc.
Greyline Instruments Inc.
204 150th Avenue

Long Sault, Ont. K0C 1P0 Madeira Beach, FL 33708

RMA# RMA#



LIMITED WARRANTY

Greyline Instruments warrants, to the original purchaser, its products to be free from defects in material and workmanship for a period of one year from date of invoice. Greyline will replace or repair, free of charge, any Greyline product if it has been proven to be defective within the warranty period. This warranty does not cover any expenses incurred in the removal and re-installation of the product.

If a product manufactured by Greyline should prove defective within the first year, return it freight prepaid to Greyline Instruments along with a copy of your invoice.

This warranty does not cover damages due to improper installation or handling, acts of nature, or unauthorized service. Modifications to or tampering with any part shall void this warranty. This warranty does not cover any equipment used in connection with the product or consequential damages due to a defect in the product.

All implied warranties are limited to the duration of this warranty. This is the complete warranty by Greyline and no other warranty is valid against Greyline. Some states do not allow limitations on how long an implied warranty lasts or limitation of incidental or consequential damages, so the above limitations or exclusions may not apply to you.

This warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

Greyline Instruments Inc.




APPENDIX A - OPTIONS

EXTRA SENSOR CABLE (OPTION XC)


Each Greyline OCF 5.0 includes 25 ft. (7.6m) RG62AU coaxial cable. Additional RG62AU coaxial cable and Cable Junction Box (Option JB) may be ordered with the Flow Monitor, or the cable may be spliced and extended up to 500 ft (152m) as required during installation. No adjustment is required when the sensor cable is extended or shortened. Use only RG62AU (or RG62U) coaxial cable which is available from Greyline Instruments or your local distributor. Nominal impedance of RG62AU cable is 93 ohms.

Extended sensor cable must be installed in metal conduit to prevent interference. Do not use BNC coaxial connectors (TV cable type). Recommended installation with a metal junction box is illustrated below:

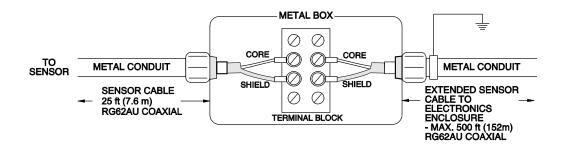

Note: Optional Watertight steel NEMA4 Junction Boxes with terminal strips (Option JB) are available from Greyline Instruments.

DIMENSIONS OPTION JB - JUNCTION BOX

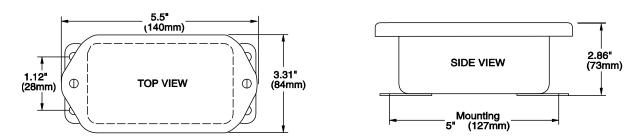




SENSOR INTRINSIC SAFETY (OPTION ISB)

When connected through Intrinsic Safety Barriers, Greyline PZ** Series sensors are certified for installation in a hazardous location rated:

Class I, Groups C,D Class II, Groups E,F,G Class III


The Intrinsic Safety Barrier may be ordered with the Greyline instrument and is supplied mounted in the Greyline instrument enclosure. Replacement barrier fuses (Part No. ISB- 011239) may be purchased separately. The instrument enclosure containing the ISB Intrinsic Safety Barrier must be installed in a non-hazardous location.

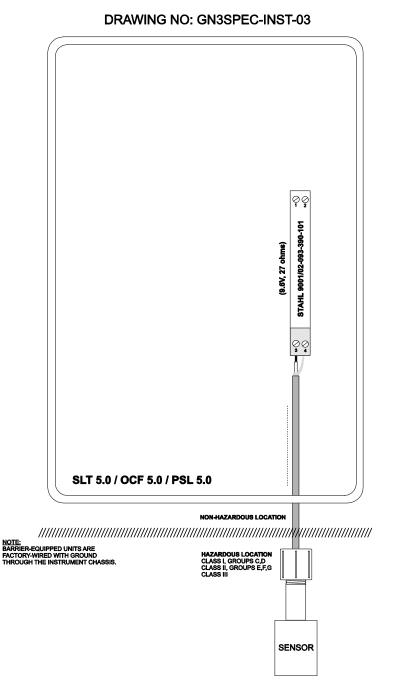



ENCLOSURE HEATER AND THERMOSTAT - Option TH

Instruments can be factory-equipped with an Enclosure Heater and Thermostat or the module can be customer-installed. The Thermostat is factory set to turn ON at 40°F (4.5°C) and OFF at 60°F (15.5°C). Power consumption is 15 Watts.

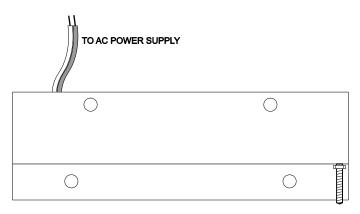

ENCLOSURE SUNSCREEN - Option SCR


Do not mount instrument electronics in direct sunlight. Overheating will reduce the life of electronic components and condensate may form during the heat/cool cycles and cause electrical shorts.

Note:

Exposure to direct sunlight can cause overheating and moisture condensation which will reduce the operating life of electronics.

Protect Instruments from direct sunlight with this iridite finished aluminum sun screen (Greyline Option SCR).

Seal conduit entries with caulking compound to further reduce moisture condensation.

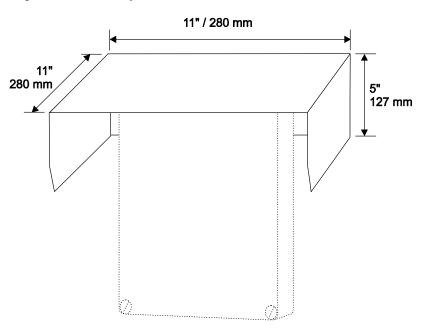



POWER INPUT OPTION 9-32VDC


OCF 5.0 Level & Flow Monitors may be ordered factory-configured for 9-32VDC power input.

QUICK BENCH TEST:

Connect Sensor as shown below, then Power. When properly connected figures will show on the large LCD display. Test operation of the OCF 5.0 by holding the sensor steadily and aiming at a flat, stable target 12 to 28" (305 to 711 mm) away from the end of the sensor. Allow a few seconds for the OCF 5.0 to lock onto the target before displaying its distance. The OCF 5.0 will now display Range in ft or cm (factory calibration).

CONNECTIONS:

POWER INPUT: Connect 9-32VDC/0.5 Amps to the + and - terminals. The Power Input GND must be connected to the nearest Ground pole. A 1 amp fuse in line is recommended.

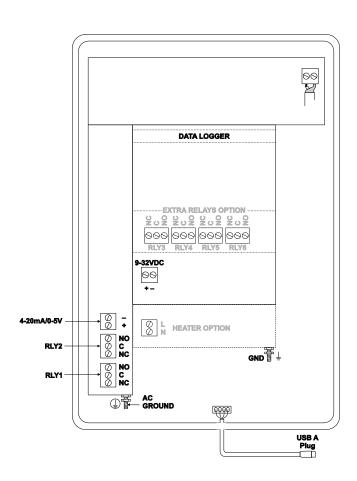



CONVERSION GUIDE					
FROM	ТО	MULTIPLY BY			
US GALLONS	CUBIC FEET	0.1337			
US GALLONS	IMPERIAL GALS	0.8327			
US GALLONS	LITRES	3.785			
US GALLONS	CUBIC METERS	0.003785			
LITRES/SEC	GPM	15.85			
LITRES	CUBIC METERS	0.001			
BARRELS	US GALLONS	42			
BARRELS	IMPERIAL GALS	34.9726			
BARRELS	LITRES	158.9886			
INCHES	MM	25.4			
DEGREES F	DEGREES C	(°F-32) x 0.556			
POUNDS	KILOGRAMS	0.453			
PSI	BAR	0.0676			
FOOT ²	METER ²	0.0929			

VOLUME CALCULATION FOR ROUND TANKS: 3.142 x R2 x H

R = TANK RADIUS (½ TANK DIAMETER) H = TANK HEIGHT



SPECIFICATIONS

Accuracy: ±0.25% of Range or 2

> mm, whichever is greater Repeatability

and Linearity: 0.1% F.S.

White, backlit matrix -Displays:

displays flow rate, totalizer, relay states, operating mode and

calibration menu

Calibration: built-in 5-key calibrator

with English. French or Spanish language

100-240VAC, 50/60Hz, **Power Input:**

30 Watts or

9-32VDC, 9 Watts max Isolated 4-20mA (1000 Output:

ohm load max.)

Control Relays: Qty 2, rated 5 amp 240VAC SPDT, programmable flow alarm and/or

proportional pulse

Enclosure: watertight, dust tight NEMA4X (IP 66) polycarbonate with a clear

shatter-proof face

Environmental Conditions: Relative humidity up to 80% -23 to 60°C ambient temperature.

maximum 5000 m altitude, pollution degree 4, Installation Category II.

~4.25" (108 mm) OVERALL

3.125" 79.4 mm

25 ft (7.6 m) RG62AU COAXIAL CABLE (50 ft 15 m OR 100 ft 30 m OPTIONAL

3/4" NPT

2.1" (53 mm)

ISOLATION COUPLING (SUPPLIED)

1.125" (28.6 mm)

Sensitivity: adjustable. Damping: adjustable

Electrical Surge Protection: Sensor, 4-20mA output and AC power input

Approximate Shipping Weight: 10 lbs (4.5 kg)

Standard Sensor PZ15

Maximum Range: 15 ft (4.57 m) Minimum Range (Deadband): 8" (203.2 mm)

> Operating Frequency: 92 KHz

Beam Angle:

Operating Temperature: -40° to 150° (-40° to 65°C) **Temperature Compensation:** Automatic, continuous

Max. Operating Pressure: 20 psi (1.35 bar)

PVC Sensor Face: Sensor Body: **PVC** Mounting: 34" NPT

Cable Length: 25 ft. (7.6 m) continuous

RG62AU coaxial. Optional 50 ft. (15 m) continuous


Max. Cable Length: 500 ft. (152 m) RG62AU


coaxial (splice)

Hazardous Rating: CSA rated Intrinsically Safe

II, Groups E,F,G with

Class I, Groups C,D, Class Optional Intrinsic Safety Barrier.

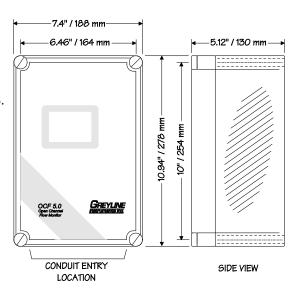





Optional Sensor PZ32T

Maximum Range: 32 ft. (10 m)

Deadband (blanking): Programmable, minimum 12" (305

mm)

Beam Angle: 8° at 3 DB

Temperature Compensation: Automatic, continuous

Operating Frequency: 42 KHz

Exposed Materials: PVC and Teflon

Operating Temperature: - 40° to 150°F (-40° to 65°C)
Operating Pressure: 20 psi (1.35 Bar) maximum

Mounting: 3/4" NPT (PVC isolation coupling

supplied)

Sensor Cable: RG62AU coaxial, 25 ft. (7.6 m)

standard


Hazardous Rating: with optional Intrinsic Safety Barrier:

CSA, Class I,II,III, Div. I,II, Groups

C,D,E,F,G

Note: Max Range reduced to 25 ft

(7.6 m) with ISB option.

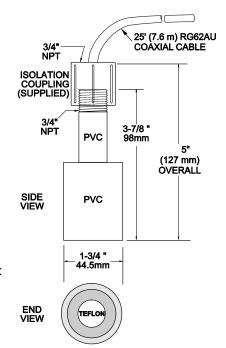

Optional Sensor PZ32TE

Maximum Range: 32 ft. (10 m)

Deadband (blanking): Programmable, minimum 12" (305

mm)

Beam Angle: 8° at 3 DB

Temperature Compensation: Automatic, continuous

Operating Frequency: 42 KHz Exposed Materials: Teflon

Operating Temperature: -40° to 170°F (-40° to 76°C)
Operating Pressure: 20 psi (1.35 Bar) maximum

Mounting: 3/4" NPT (Teflon isolation coupling

supplied)

Sensor Cable: RG62AU coaxial, 25 ft. (7.6 m)

standard

Hazardous Rating: with optional Intrinsic Safety Barrier:

CSA, Class I,II,III, Div. I,II, Groups

C,D,E,F,G,

Note: Max Range reduced to 25 ft

(7.6 m) with ISB option.

