

# **USER'S GUIDE**

Installation & Operation  
Instructions

Level & Flow Monitor  
*Model SLT 5.0*  
Manual Series A.1.2

Note: This page has been left blank intentionally.

**INDEX**

CONNECTIONS: .....	4
KEYPAD SYSTEM.....	6
CALIBRATION MENU .....	7
RUN .....	8
MESSAGE .....	8
STATUS .....	8
PASSWORD.....	9
UNITS/MODE .....	10
CALIBRATION.....	11
CHANNEL SETUP .....	14
RELAY PARAMETERS .....	15
SPECIAL FUNCTIONS .....	16
SENSOR MOUNTING/LOCATION .....	18
APPLICATIONS HOTLINE.....	22
PRODUCT RETURN PROCEDURE .....	23
APPENDIX A - OPTIONS.....	25
DATA LOGGING (Optional).....	29
CONVERSION GUIDE .....	31
SPECIFICATIONS .....	32

*IMPORTANT NOTE: This instrument is manufactured and calibrated to meet product specifications. Please read this manual carefully before installation and operation. Any unauthorized repairs or modifications may result in a suspension of the warranty.*

*Available in Adobe Acrobat pdf format*

**CONNECTIONS:**

**POWER INPUT:** The standard model requires AC power input between 100 to 240 VAC 50/60Hz . No adjustments are necessary for voltages within this range.

Optional DC input model requires 9-32 VDC/9 Watts. Connect to + and - terminals.

Optional Thermostat and Heater modules are available rated for 115 VAC or 230 VAC.

**IMPORTANT NOTE:** To comply with CSA/UL electrical safety standards, AC power input and relay connection wires must have conduit entry to the instrument enclosure. Installation requires a switch, overcurrent fuse or circuit breaker in the building (in close proximity to the equipment) that is marked as the disconnect switch.




Risk of electric shock. Loosen cover screw to access connections. Only qualified personnel should access connections.

Note: Use of instrumentation over 40°C ambient requires special field wiring.

Note: User replaceable fuse is 2 Amp 250V (T2AL250V).


## CONNECTIONS

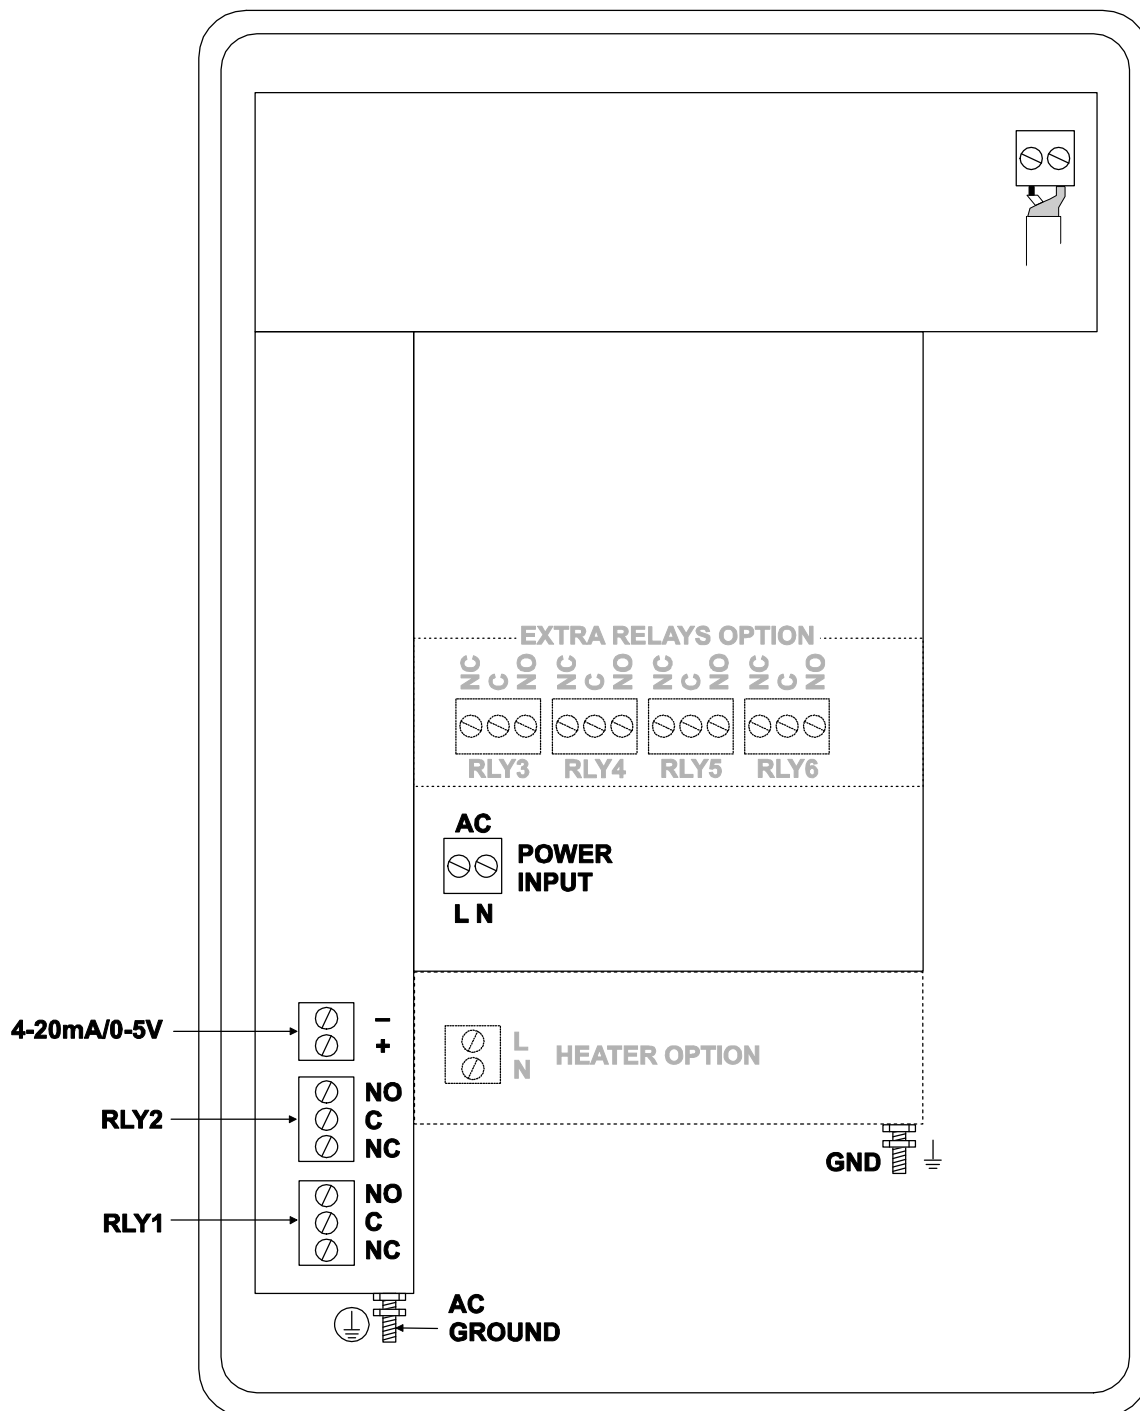


## **KEYPAD SYSTEM**

The following diagram shows the SLT 5.0 menu system. Arrows show the four directions to leave a menu box. Pressing a corresponding keypad arrow will move to the next item in the direction shown. Move the cursor (underline) under numerals and increase or decrease numerals with the **▲** and **▼** keys.

To store calibration values permanently (even through power interruptions), press the **✓**.

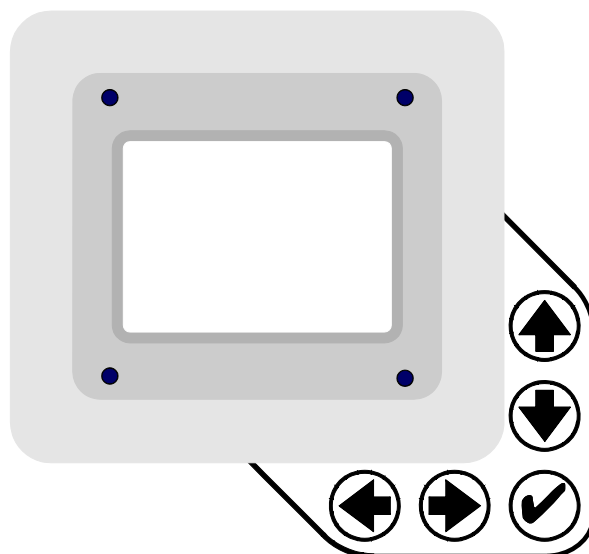

## CALIBRATION MENU

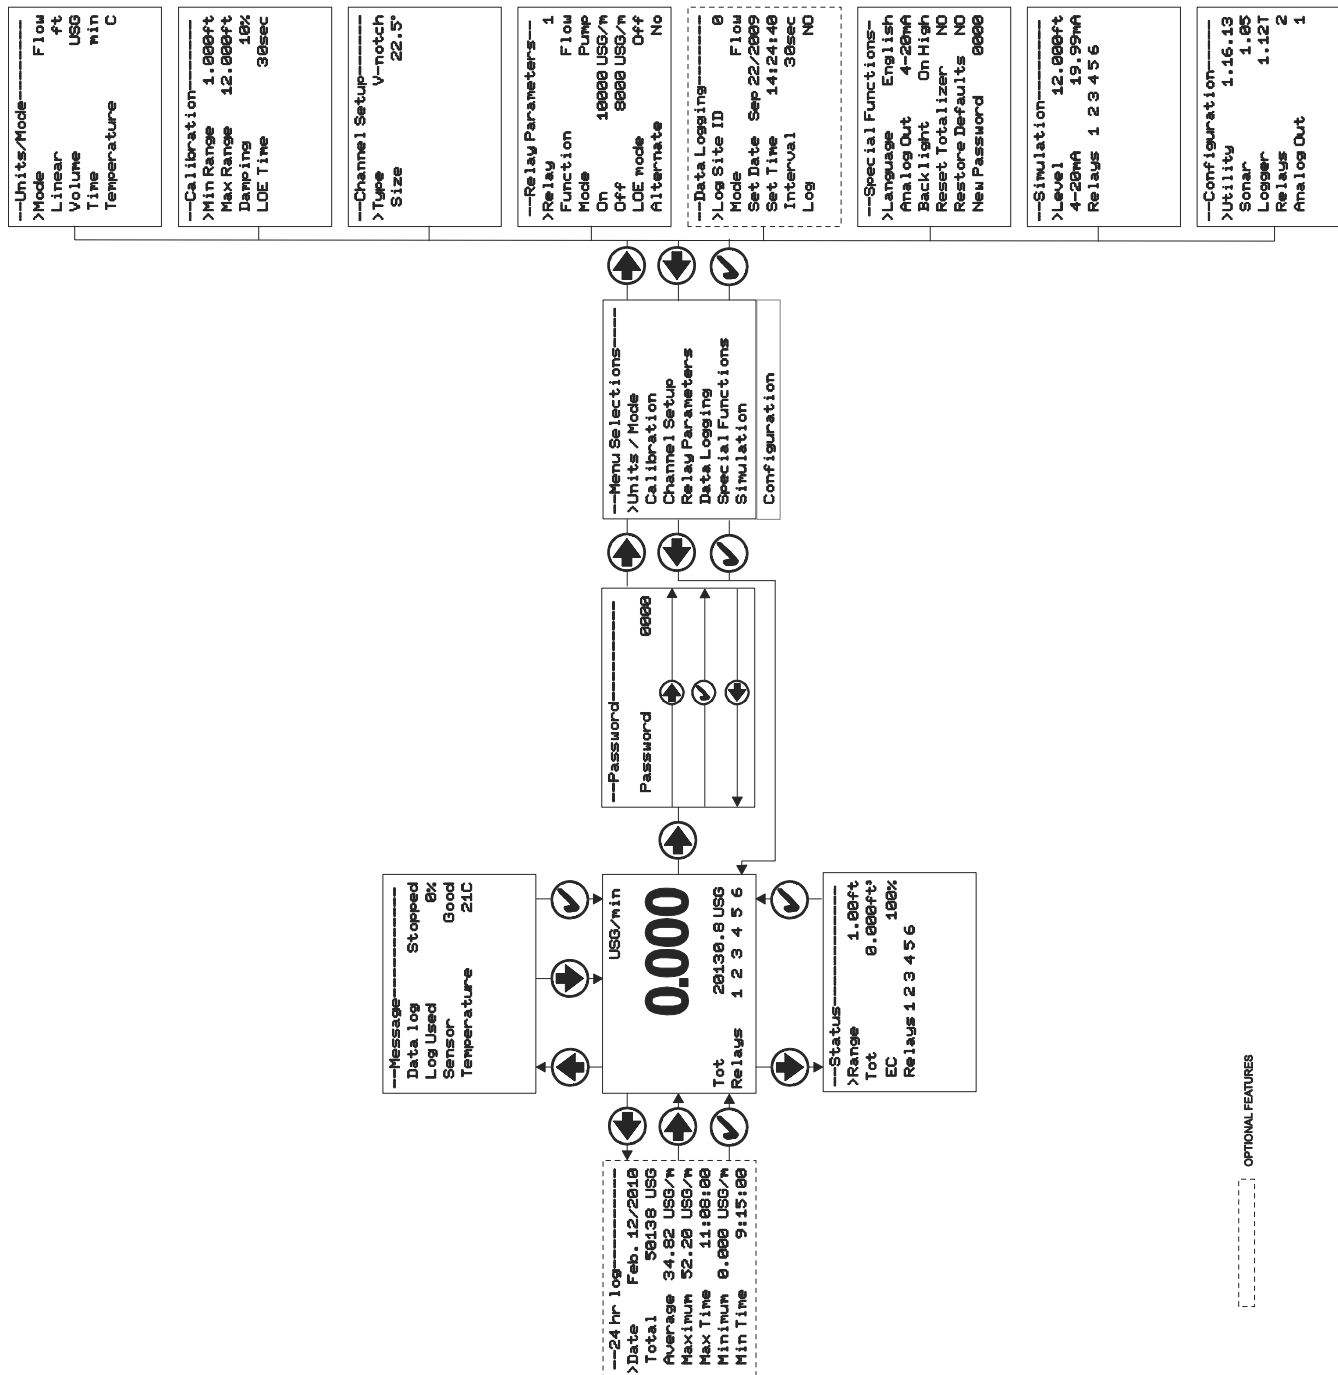

```

USG/min
0.000
Tot      20130.8 USG
Relays   1 2 3 4 5 6
  
```

```

--Message-----
Data log      Stopped
Log Used      0%
Sensor        Good
Temperature    21C
  
```

```

--Status-----
>Range        1.00ft
Tot           0.000ft³
EC            100%
Relays 1 2 3 4 5 6
  
```

```

--24 hr log-----
>Date         Feb. 12/2010
Total         50138 USG
Average       34.82 USG/m
Maximum       52.20 USG/m
Max Time      11:08:00
Minimum       0.000 USG/m
Min Time      9:15:00
  
```

## RUN

The main display shows the units selected from the Units/Mode menu, Level, Range, Flow, HRT, and Volume rate being measured, TOTALIZER and RELAY states. The SLT 5.0 will start-up with this display and will return to this screen after a timeout if keys are not pressed in other menus.

## MESSAGE

Press **↑** from the RUN display to view status of the data logger and error/warning messages provided by the instrument. The word Message will appear on the RUN display if error messages are being generated by the instrument. Refer to the manual section Error/Warning Messages for a description. Press **✓** to return to the main display.

## STATUS

Press **↓** from the RUN display to view instrument status. Range will be displayed in linear units.

**Tot**            Displays the current totalizer reading.


**EC**            Displays echo confidence.

**Relays**       Energized relays will display as a white character on a black background.

## 24 HR LOG (Data Logging option only)

Press **←** from the RUN display to view a formatted flow report from instruments with a built-in data logger. Press **↓** to scroll down one day or repeatedly to scroll to a specific date. Up to 365 days can be stored. Newest date will overwrite the oldest. Press **✓** to return to the main display.



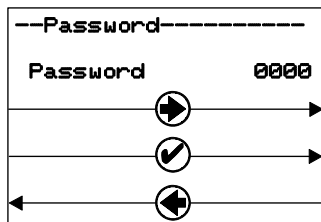

## **PASSWORD**

The password (a number from 0000 to 9999) prevents unauthorized access to the Calibration menu.

From the Run display press the ➡ key to get to **PASSWORD**. Factory default password is 0000 and if it has not been changed press the ✓ to proceed to the Menu Selections screen.

If a password is required, press ➡ to place the cursor under the first digit and ↓ or ↑ to set the number, then ➡ to the second digit, etc. Press ➡ or ✓ to proceed to the Menu Selections screen.

A new password can be stored by going to **Special Functions/New Password**.

```

--Units/Mode-----
>Mode                Flow
Linear               ft
Volume              USG
Time                min
Temperature          C
  
```

```

--Units/Mode-----
Mode                Flow
>Linear             in
                   ft
                   m
                   mm
  
```

```

--Units/Mode-----
>Volume             USG
                   ft3
                   bbl
                   L
                   m3
                   IMG
                   IG
                   USMG
  
```

```

--Units/Mode-----
>Temperature        C
                   F
  
```

## UNITS/MODE

From >Mode press the ➡ and then the ⬆ or ⬇ to select Level, Range, Flow, HRT or Volume.

**Range** mode displays distance from the sensor to the target or liquid surface like a tape measure. Range mode is useful to measure the exact distance from the sensor to the zero level during calibration, or to monitor "outage" or free space in a tank.

**Level** mode can be used to measure tank level in linear units, or "Head" (height of flow) in an open channel for comparison with a flume manufacturer's flow tables.

**Volume** Volume mode displays tank inventory in engineering units like gallons or liters.

**HRT** Horizontal Round Tank mode sets the SLT 5.0 to calculate and display volume units in a horizontal round tank.

**Flow** mode is for open channel flow through a flume or weir.

From Volume HRT or Flow press ➡ to make your selection. (Range or Level mode will bypass the Volume units selection menu). Volume Hrt or Flow modes will give you the additional choice of volumetric units:

ft3	-	cubic feet
USG	-	US gallons
USMG	-	US million gallons (FLOW only)
IG	-	Imperial gallons
IMG	-	Imperial million gallons (FLOW only)
m3	-	cubic meters
L	-	liters
bbl	-	U.S. oil barrel

Press the ✓ to store your selection then the ⬇ to the next menu item and ➡ to enter.

From >Linear press the ➡ key and then the ⬆ or ⬇ to select your units of measurement. Press the ✓ to store your selection.

Press the ⬇ key to move the > symbol to each subsequent menu item and the ✓ to save your selections.

> Temperature ➡ then ⬆⬇ to select C or F.

Press ⬅ or ✓ to return to the Menu Selections screen.

--Calibration-----	
>Min Range	1.000ft
Max Range	12.000ft
Damping	10%
LOE Time	30sec

## **CALIBRATION**

Press the **↓** to **>Calibration** and **→** to enter. Use **↓** or **↑** to position **>** before each menu item and **→** to enter. When settings are completed press **✓** to store and return to the Calibration menu.


**MaxVol** - For Volume and HRT mode only. Enter the maximum volume of the vertical or horizontal tank.

**Damping** - Minimum damping allows fast response to level changes. Increasing damping slows the SLT 5.0's response to level changes and is ideal to smooth the display and outputs in turbulent conditions. Damping value is shown in percent (0-99%). Some experimentation may be required to select the optimum damping value. A value of 1% is recommended for most applications. For fast level changes (up to ½ inch/sec - 13 mm/sec), a Damping value of 1% is recommended.

**LOE Time** - Press **→** and **↑** or **↓** to change the number of seconds without receiving an echo before the SLT 5.0 displays ECHO LOSS, and Control relays change state as calibrated under Relay Parameters.

Factory default is 30 seconds and is recommended for most applications, Minimum is 1 second and maximum is 99 seconds.

Press **✓** from the **Units/Mode** display to return to Menu Selections.

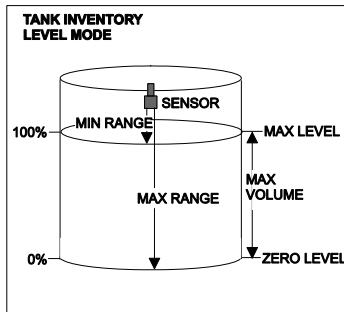

## CALIBRATION


### - for Level/Inventory Applications

1. Before starting the calibration determine:

a) MAX RANGE = \_\_\_\_\_  
(Maximum range = distance from Sensor to Zero level)


b) MAX LEVEL = \_\_\_\_\_  
(Maximum level of product being measured)

c) MIN RANGE = \_\_\_\_\_  
(Distance from sensor to Max Level)  
Minimum range = MAX RANGE - MAX LEVEL  
(must be at least 8" / 203 mm depending on sensor model)

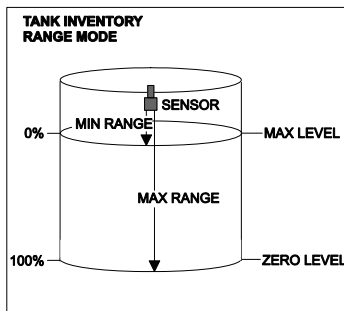

2. Check the maximum range with the sensor installed by:

- When liquid is at zero level press  $\downarrow$  to view the Range reading in the Status menu. Use this range measured by the SLT 5.0 as the Max Range setting.  
or
- Carefully measure distance from sensor to zero level with a tape measure, and use this measurement as the Max Range setting.

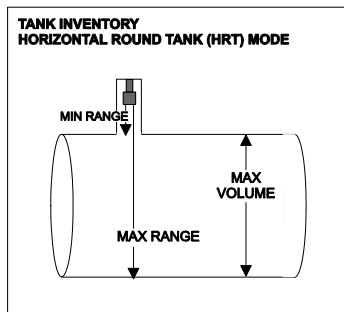

## MINIMUM RANGE:


At CALIBRATION

- Press  $\downarrow$  to get to Min Range
- Press  $\rightarrow$  to move the cursor under the digits
- Use  $\downarrow$  or  $\uparrow$  to set the minimum range

*Note:* Min Range must be at least 12" (30.5 cm) for PZ32T sensors, 16" (40.6 cm) for PZ52T and PZ34 sensors and 8" for PZ15 sensors. For correct tank volume calculation in Hrt mode Min Range must be the actual distance from the end of the sensor to the top of the tank.

## MAXIMUM RANGE:

Press  $\downarrow$  to get to Max Range  
Enter Max Range determined above.

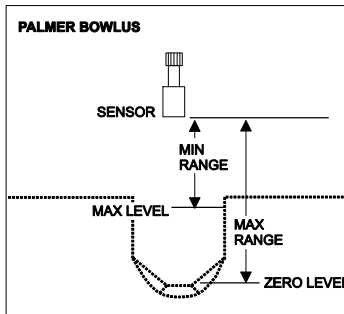


## CALIBRATION

### - for Open Channel Flow

1. Before starting the calibration determine:

- a)  $\text{MAX RANGE} = \underline{\hspace{2cm}}$   
(Maximum range = distance from the Sensor to Zero flow point)
- b)  $\text{MAX LEVEL} = \underline{\hspace{2cm}}$   
(Maximum level of flow through flume or weir)
- c)  $\text{MIN RANGE} = \underline{\hspace{2cm}}$   
(Distance from sensor to Max Level)  
 $\text{Minimum range} = \text{MAX RANGE} - \text{MAX LEVEL}$   
(must be at least 8" / 20.3 cm depending on sensor model).

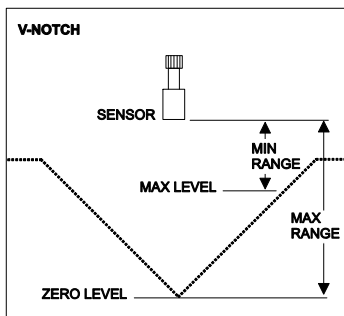

2. Check the maximum range with the sensor installed by:

- a) When liquid is at zero level press  $\blacktriangledown$  to view the Range reading in the Status menu. Use this range measured by the SLT 5.0 as the Max Range setting.  
or
- b) Carefully measure distance from sensor to zero level with a tape measure, and use this measurement as the Max Range setting.

NOTE: The SLT 5.0 will not detect targets beyond user entered MaxRg.

## CHANNEL SETUP

```
--Channel Setup-----
>Type      V-notch
           Custom
           Khafagi
           Rect Weir w/EC
           Rect Weir
           Trapezidal
           Leopld-Lagco
           Palmer Bowlus
           Parshall
```

```
--Channel Setup-----
>Type      V-notch
Size      22.5°
           120°
           90°
           60°
           45°
           30°
```

```
--Channel Setup-----
>Type      Custom
K          0.0000
n          0.0000
```

```
--Channel Setup-----
>Type      Khafagi
Height     0.000ft
```

```
--Channel Setup-----
>Type      RECT Weir w/EC
Height     0.000ft
```

```
--Channel Setup-----
>Type      RECT Weir
Height     0.000ft
```

```
--Channel Setup-----
>Type      Trapezidal
Size      Extra large 60°
           Large 60°
           Small 60°
           12in 45° SRCRC
           2in 45° WSC
           8in 60°
```

```
--Channel Setup-----
>Type      Leopld-Lagco
Size      36in
           30in
           24in
           18in
           12in
           10in
           8in
           6in
```

```
--Channel Setup-----
>Type      Palmer Bowlus
Size      48in
           42in
           36in
           30in
           27in
           24in
           21in
           18in
           15in
           12in
           10in
           8in
           6in
           4in
```

```
--Channel Setup-----
>Type      Parshall
Size      12ft
           10ft
           8ft
           6ft
           5ft
           4ft
           3ft
           2ft
           18in
           12in
           9in
           6in
           3in
           2in
           1in
```

```
--Relay Parameters--
>Relay      1
Function    Flow
Mode        Pump
On          10000 USG/m
Off         8000 USG/m
LOE mode    Off
Alternate   NO
```

## RELAY PARAMETERS

**Relay** Press **➡** and **⬇** or **⬆** to select a corresponding relay number (2 relays are standard, 4 additional are optional).

**Function** Press **⬇** or **⬆** to select Off, Temperature, Pulse and Level.

**Temperature** References temperature reading from the SLT 5.0 ultrasonic sensor (air temperature at the sensor location). Press **⬇** and **➡** and set the relay On and Off set points.

**Pulse** Press **⬇** and set digits to the flow volume increment required between relay pulses. Use this feature for remote samplers, chlorinators or totalizers. Minimum time between pulses is 2.25 seconds and pulse duration is 350 milliseconds.

**Level** Appears in Level, Range, Volume or HRT modes only. Press **⬇** to **R Function** and **➡** to select **Pump**, **LoAlm** (low alarm) or **HiAlm** (high alarm).

Press **✓** to return to **Menu Selections**.

```
--Relay Parameters--
>Relay      1
Function Temperature
On          0.0C
Off         9.0C
```

```
--Relay Parameters--
>Relay      1
Function    Pulse
On          10.000ft³
```

```
--Relay Parameters--
>Relay      1
Function    Level
Mode        Pump
On          12.000ft
Off         3.000ft
LOE mode    Off
Alternate   NO
```

## DATA LOGGING (OPTIONAL)

Refer to Options section of this manual.

```
--Special Functions--
>Language      English
Analog Out     4-20mA
Backlight      On High
Reset Totalizer NO
Restore Defaults NO
New Password    0000
```

```
--Special Functions--
Language      English
>Backlight     On High
               On Med
               On Low
               Key Hi/Lo
               Key High
               Key Med
               Key Low
               Off
```

## SPECIAL FUNCTIONS

Language	Select English, French or Spanish and press ✓.
Analog Out	Select 4-20mA or 0-5V mode for the analog output.
Backlight	Select On High, Medium or Low for continuous backlight.  Select Key Hi/Lo for high backlight for 1 minute after a keypress and then Lo backlight until a key is pressed again.  Select Key High, Med or Low for backlight for 1 minute after a keypress and then backlight off until a key is pressed again.
Reset Totalizer	Press ➡ and select Yes to erase and restart the totalizer at zero.
Restore Defaults	Select Yes and press ✓ to erase all user settings and return the instrument to factory default settings
New Password	Select any number from 0000 to 9999 and press ✓. Default setting of 0000 will allow direct access to the calibration menus. Setting of any password greater than 0000 will require the password to be entered to access the calibration menus.

Press ✓ to return to Menu Selections.



```
--Simulation-----  
>Level      9.981ft  
4-20mA      18.52mA  
Relays  1 2 3 4 5 6
```

## **SIMULATION**

Exercises the 4-20mA output, digital display and control relays.

Press **➡** and then **⬇** or **⬆** to change the simulated output. Press **✓** to begin simulation. The 4-20mA output and relay states will be displayed on the screen below.


Press the **✓** to terminate simulation and return to the Menu Selections screen.

## SENSOR MOUNTING/LOCATION







### - Tank Level/Inventory Applications

Each SLT 5.0 Level Transmitter includes a non-contacting ultrasonic sensor. The sensor must be installed in a position to obtain unobstructed echoes from the liquid or material being measured.







Mount the sensor away from pipes, ladders, or structural members which might cause continuous false echoes.

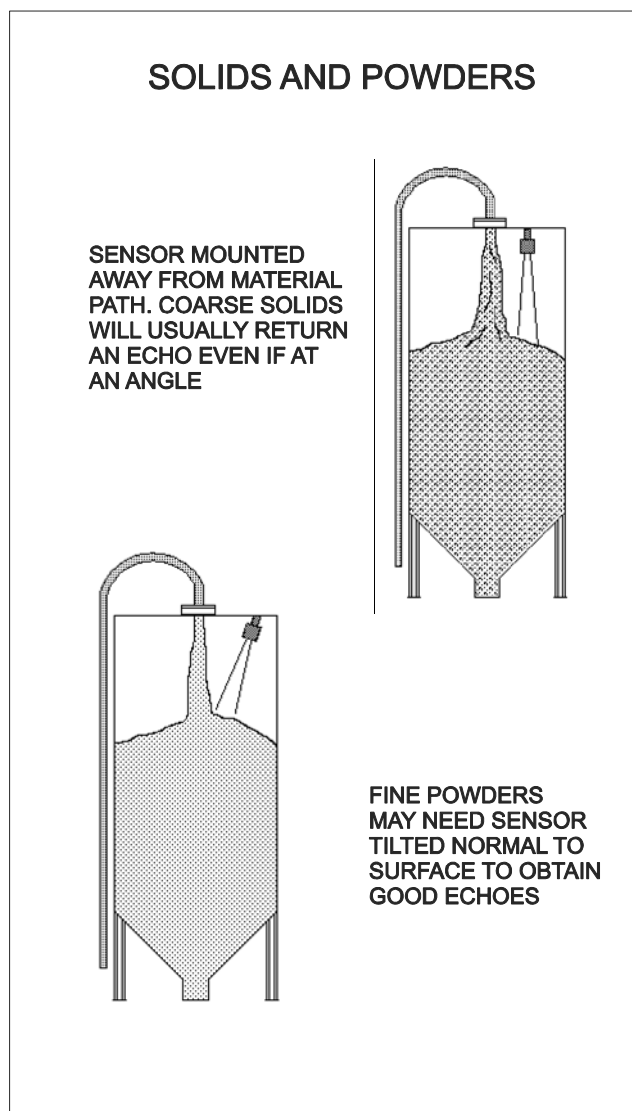

## BAD

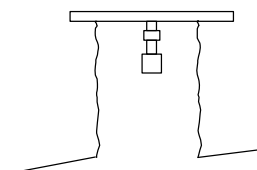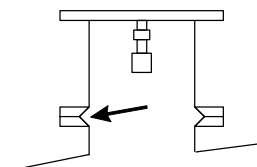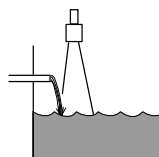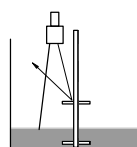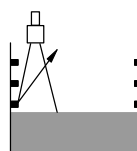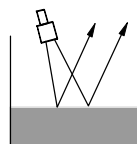


## GOOD

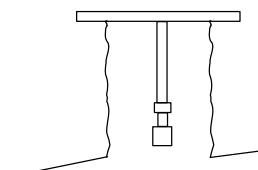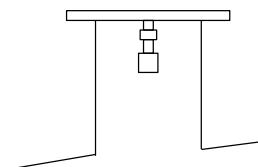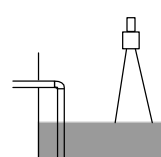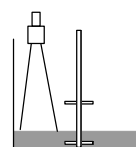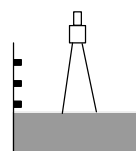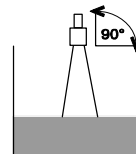

## **SENSOR MOUNTING LOCATION**

**- Tank Level/Inventory Applications**

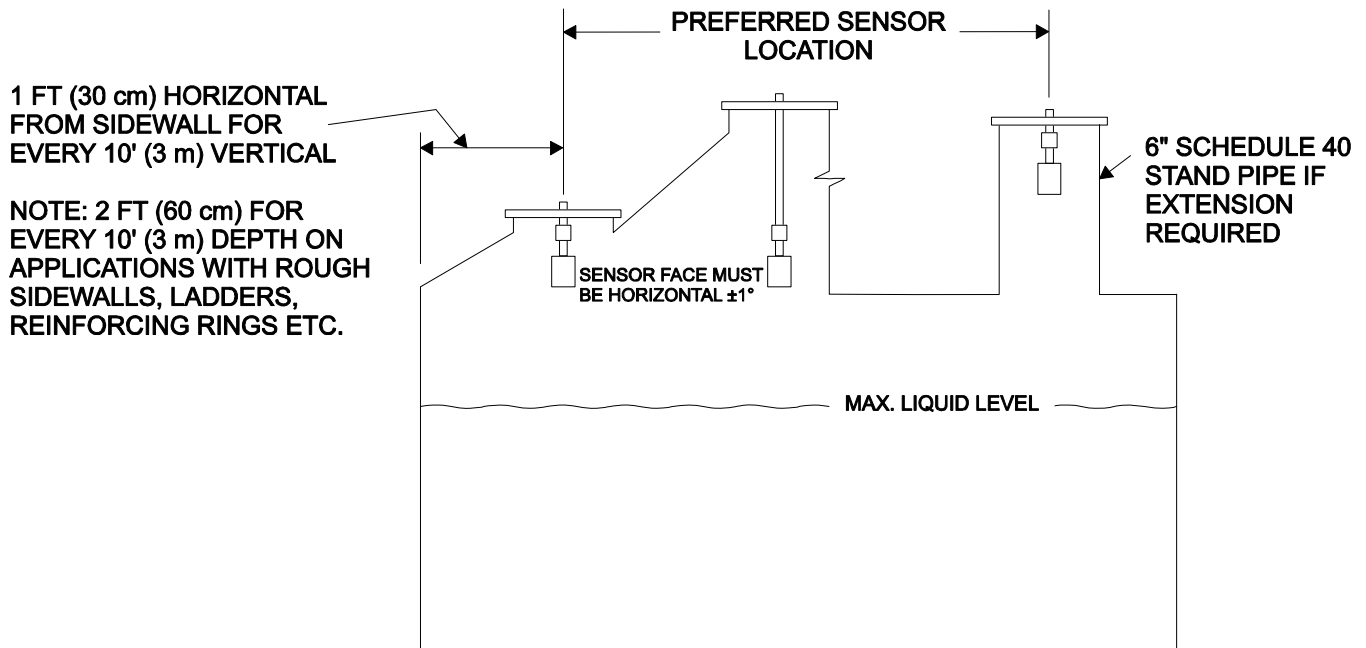

## **SENSOR MOUNTING**

Each sensor is equipped with a  $\frac{3}{4}$  inch "isolation coupling" which **MUST** be used in your installation. A threaded nipple or length of conduit may be used to position the sensor at the desired height.

The sensor should be hand-tightened (like a light bulb) by turning the sensor stem only. **DO NOT** use a wrench and do not over tighten. **DO NOT** clamp the sensor below the isolation coupling.

## **ENCLOSURE INSTALLATION**

Locate the enclosure within 20 ft (6 m) of the sensor (500 ft -150 m optional). The enclosure can be wall mounted with the four mounting screws (included) or panel mounted with Option PM Panel Mount kit from Greyline Instruments.


Avoid mounting the enclosure in direct sunlight to protect the electronics from damage due to overheating and condensate. In high humidity atmospheres, or where temperatures fall below freezing, Option TH Enclosure Heater and Thermostat is recommended. Seal conduit entries to prevent moisture from entering enclosure.

### **NEMA4X (IP66) WITH CLEAR COVER**

1. Open hinged enclosure cover.
2. Insert #8 screws (supplied) through the four enclosure mounting holes to secure the enclosure to the wall or mounting stand.

Additional conduit holes can be cut in the bottom of the enclosure when required. Use a hole saw or Greenlee-type hole cutter to cut the required holes.

**DO NOT** make conduit/wiring entries into the top of the enclosure.

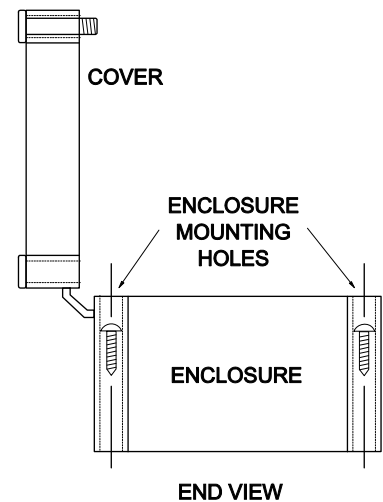

Note: This non-metallic enclosure does not automatically provide grounding between conduit connections. Grounding must be provided as part of the installation. Ground in accordance with the requirements of the National Electrical Code. System grounding is provided by connecting grounding wires from all conduit entries to the steel mounting plate or another point which provides continuity.

## **CLEANING**

Cleaning is not required as a part of normal maintenance.

## PZxx Series Sensors

### Troubleshooting

Resistance measured (between the shield and centre wire) across the coaxial cable ends by multimeter indicates ambient temperature.

### Resistance vs. Temperature

*Values are in Ohms*

Temp °C	+0	+1	+2	+3	+4	+5	+6	+7	+8	+9
0	10000.0	10039.0772	10078.1429	10117.1970	10156.2396	10195.2706	10234.2901	10273.2980	10312.2944	10351.2792
10	10390.2525	10429.2142	10468.1644	10507.1030	10546.0301	10584.9456	10623.8496	10662.7420	10701.6229	10740.4922
20	10779.3500	10818.1962	10857.0309	10895.8540	10934.6656	10973.4656	11012.2541	11051.0310	11089.7964	11128.5502
30	11167.2925	11206.0232	11244.7424	11283.4500	11322.1461	11360.8306	11399.5036	11438.1650	11476.8149	11515.4532
40	11554.0800	11592.6952	11631.2989	11669.8910	11708.4716	11747.0406	11785.5981	11824.1440	11862.6784	11901.2012
50	11939.7125									

© 2009 Minco, All Rights Reserved

*Values are in Ohms*

Temp °F	+0	+1	+2	+3	+4	+5	+6	+7	+8	+9
30			10000.0	10021.7110	10043.4184	10065.1223	10086.8226	10108.5193	10130.2125	10151.9021
40	10173.5881	10195.2706	10216.9495	10238.6249	10260.2967	10281.9649	10303.6295	10325.2906	10346.9481	10368.6021
50	10390.2525	10411.8993	10433.5426	10455.1823	10476.8184	10498.4510	10520.0800	10541.7054	10563.3273	10584.9456
60	10606.5604	10628.1716	10649.7792	10671.3832	10692.9837	10714.5806	10736.1740	10757.7638	10779.3500	10800.9327
70	10822.5118	10844.0873	10865.6593	10887.2277	10908.7925	10930.3538	10951.9115	10973.4656	10995.0162	11016.5632
80	11038.1067	11059.6466	11081.1829	11102.7156	11124.2448	11145.7704	11167.2925	11188.8110	11210.3259	11231.8373
90	11253.3451	11274.8493	11296.3500	11317.8471	11339.3406	11360.8306	11382.3170	11403.7999	11425.2792	11446.7549
100	11468.2270	11489.6956	11511.1606	11532.6221	11554.0800	11575.5343	11596.9851	11618.4323	11639.8759	11661.3160
110	11682.7525	11704.1854	11725.6148	11747.0406	11768.4629	11789.8816	11811.2967	11832.7082	11854.1162	11875.5206
120	11896.9215	11918.3188	11939.7125							

© 2009 Minco, All Rights Reserved

***APPLICATIONS HOTLINE***

For applications assistance, advice or information on any Greyline Instrument contact your Sales Representative, write to Greyline or phone the Applications Hotline below:

United States:	Tel: 315-788-9500	Fax: 315-764-0419
Canada:	Tel: 613-938-8956	Fax: 613-938-4857
Toll Free:	888-473-9546	
Email:	info@greyline.com	
Web Site:	<a href="http://www.greyline.com">www.greyline.com</a>	

Greyline Instruments Inc.

Canada  
16456 Sixsmith Drive  
Long Sault, Ont. K0C 1P0

USA:  
105 Water Street  
Massena, NY 13662

## **PRODUCT RETURN PROCEDURE**

Instruments may be returned to Greyline for service or warranty repair.

### **1) Obtain an RMA Number from Greyline -**

Before shipping a product to the factory please contact Greyline by telephone, fax or email to obtain an RMA number (Returned Merchandise Authorization). This ensures fast service and correct billing or credit.

When you contact Greyline please have the following information available:

1. Model number / Software Version
2. Serial number
3. Date of Purchase
4. Reason for return (description of fault or modification required)
5. Your name, company name, address and phone number

### **2) Clean the Sensor/Product -**

*Important: unclean products will not be serviced and will be returned to the sender at their expense.*

1. Rinse sensor and cable to remove debris.
2. If the sensor has been exposed to sewage, immerse both sensor and cable in a solution of 1 part household bleach (Javex, Clorox etc.) to 20 parts water for 5 minutes. Important: do not immerse open end of sensor cable.
3. Dry with paper towels and pack sensor and cable in a sealed plastic bag.
4. Wipe the outside of the enclosure to remove dirt or deposits.
5. Return to Greyline for service.

### **3) Ship to Greyline -**

After obtaining an RMA number please ship the product to the appropriate address below:

Canadian and International  
Customers:

Greyline Instruments Inc.  
16456 Sixsmith Drive  
Long Sault, Ont. K0C 1P0

RMA#

USA  
Customers:

Greyline Instruments Inc.  
204 150th Avenue  
Madeira Beach, FL 33708

RMA#

## LIMITED WARRANTY

---

Greyline Instruments warrants, to the original purchaser, its products to be free from defects in material and workmanship for a period of one year from date of invoice. Greyline will replace or repair, free of charge, any Greyline product if it has been proven to be defective within the warranty period. This warranty does not cover any expenses incurred in the removal and re-installation of the product.

If a product manufactured by Greyline should prove defective within the first year, return it freight prepaid to Greyline Instruments along with a copy of your invoice.

This warranty does not cover damages due to improper installation or handling, acts of nature, or unauthorized service. Modifications to or tampering with any part shall void this warranty. This warranty does not cover any equipment used in connection with the product or consequential damages due to a defect in the product.

All implied warranties are limited to the duration of this warranty. This is the complete warranty by Greyline and no other warranty is valid against Greyline. Some states do not allow limitations on how long an implied warranty lasts or limitation of incidental or consequential damages, so the above limitations or exclusions may not apply to you.

This warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

Greyline Instruments Inc.




## APPENDIX A - OPTIONS

### EXTRA SENSOR CABLE (OPTION XC)



Each Greyline SLT 5.0 includes 25 ft. (7.6m) RG62AU coaxial cable. Additional RG62AU coaxial cable and Cable Junction Box (Option JB) may be ordered with the Flow Monitor, or the cable may be spliced and extended up to 500 ft (152m) as required during installation. No adjustment is required when the sensor cable is extended or shortened. Use only RG62AU (or RG62U) coaxial cable which is available from Greyline Instruments or your local distributor. Nominal impedance of RG62AU cable is 93 ohms.

Extended sensor cable must be installed in metal conduit to prevent interference. Do not use BNC coaxial connectors (TV cable type). Recommended installation with a metal junction box is illustrated below:

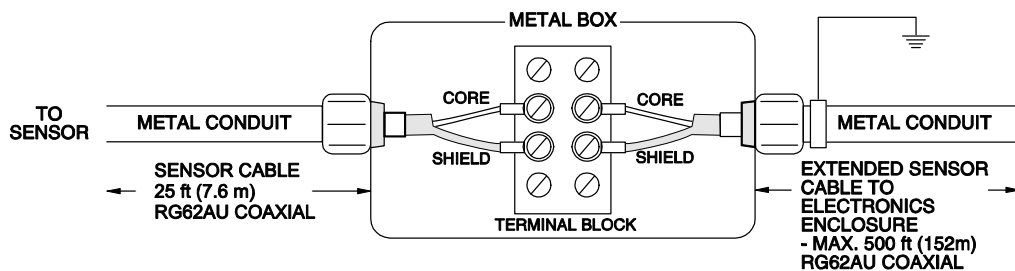

Note: Optional Watertight steel NEMA4 Junction Boxes with terminal strips (Option JB) are available from Greyline Instruments.

### DIMENSIONS OPTION JB - JUNCTION BOX

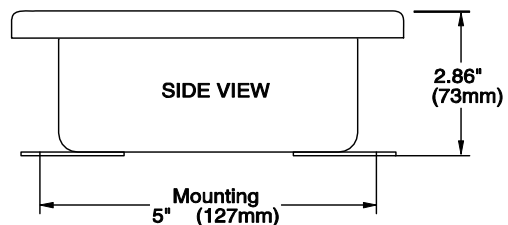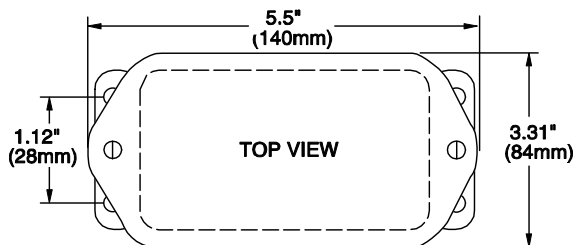


## SENSOR INTRINSIC SAFETY (OPTION ISB)

When connected through Intrinsic Safety Barriers, Greyline PZ\*\* Series sensors are certified for installation in a hazardous location rated:

Class I, Groups C,D  
Class II, Groups E,F,G  
Class III


The Intrinsic Safety Barrier may be ordered with the Greyline instrument and is supplied mounted in the Greyline instrument enclosure. Replacement barrier fuses (Part No. ISB- 011239) may be purchased separately. The instrument enclosure containing the ISB Intrinsic Safety Barrier must be installed in a non-hazardous location.

DRAWING NO: GN3SPEC-INST-03

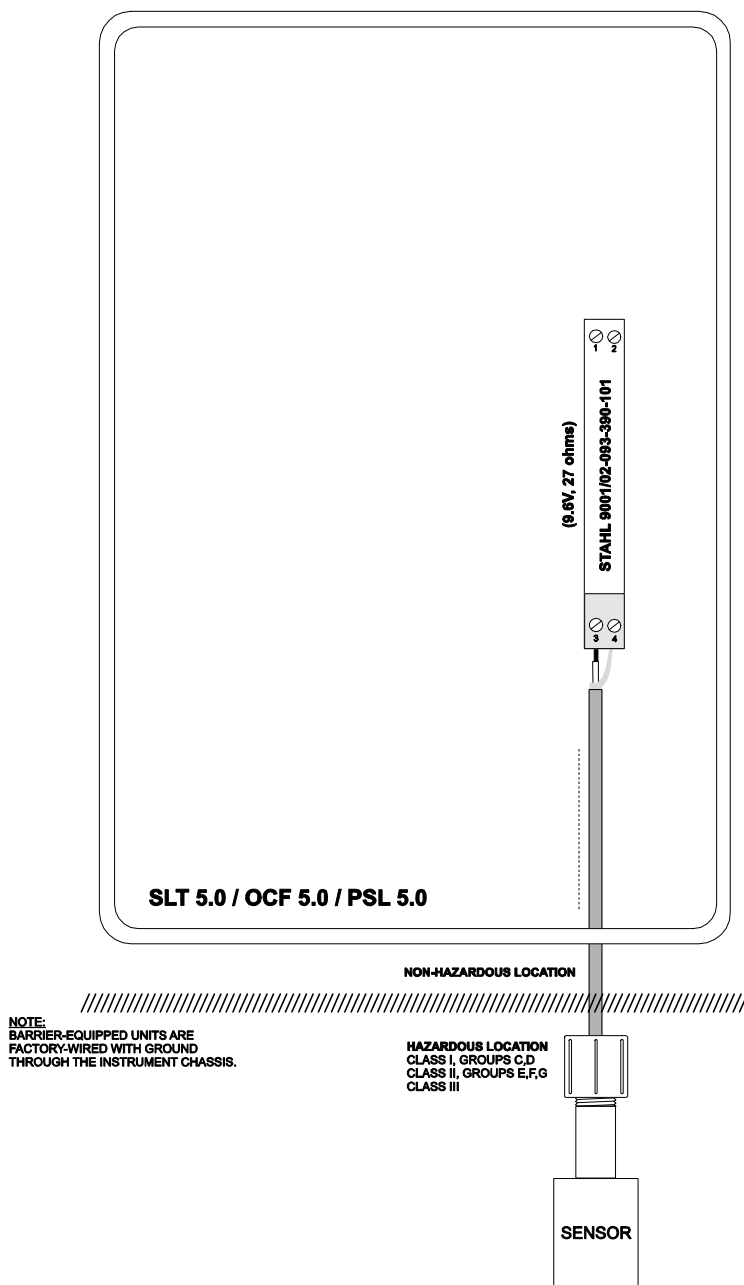

## **ENCLOSURE HEATER AND THERMOSTAT - Option TH**

Instruments can be factory-equipped with an Enclosure Heater and Thermostat or the module can be customer-installed. The Thermostat is factory set to turn ON at 40°F (4.5°C) and OFF at 60°F (15.5°C). Power consumption is 15 Watts.

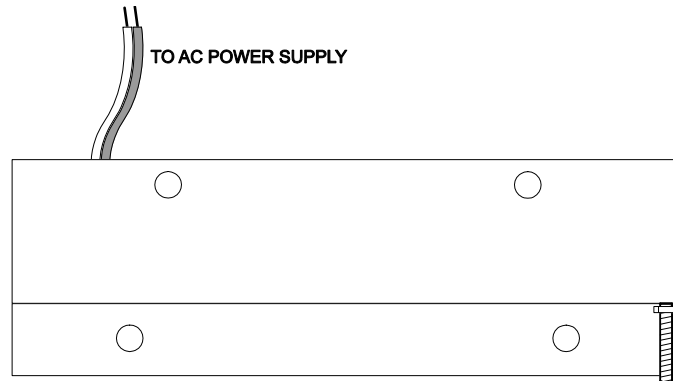

## **ENCLOSURE SUNSCREEN - Option SCR**


Do not mount instrument electronics in direct sunlight. Overheating will reduce the life of electronic components and condensate may form during the heat/cool cycles and cause electrical shorts.

### **Note:**

Exposure to direct sunlight can cause overheating and moisture condensation which will reduce the operating life of electronics.

Protect Instruments from direct sunlight with this iridite finished aluminum sun screen (Greyline Option SCR).

Seal conduit entries with caulking compound to further reduce moisture condensation.

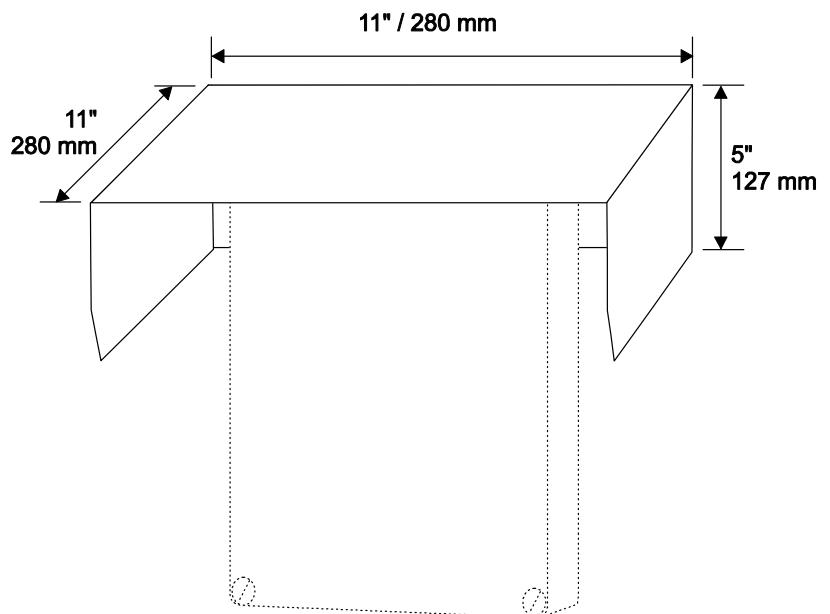

## POWER INPUT OPTION 9-32VDC


SLT 5.0 Level & Flow Monitors may be ordered factory-configured for 9-32VDC power input.

### QUICK BENCH TEST:

Connect Sensor as shown below, then Power. When properly connected figures will show on the large LCD display. Test operation of the SLT 5.0 by holding the sensor steadily and aiming at a flat, stable target 12 to 28" (305 to 711 mm) away from the end of the sensor. Allow a few seconds for the SLT 5.0 to lock onto the target before displaying its distance. The SLT 5.0 will now display Range in ft or cm (factory calibration).

### CONNECTIONS:

**POWER INPUT:** Connect 9-32VDC/0.5 Amps to the + and - terminals. The Power Input GND must be connected to the nearest Ground pole. A 1 amp fuse in line is recommended.

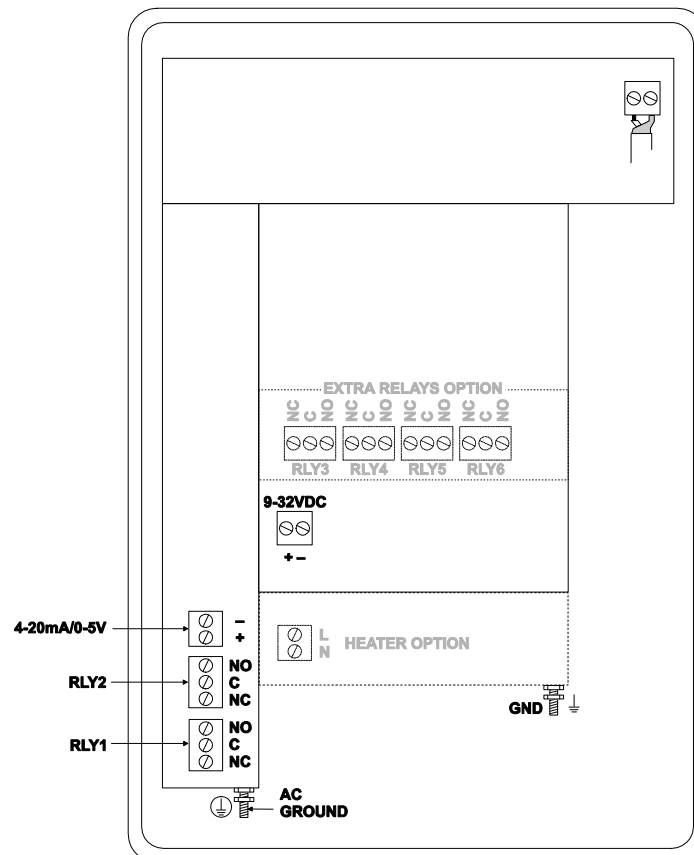

```

--Data Logging-----
>Log Site ID      00
                  99
Mode              Level
                  Range
                  Flow
                  HRT
                  Volume
Set Date Feb 18/2008
          Mar 19/2009
Set Time 11:27:40
          12:28:41
Interval 10sec
          60min
          30min
          10min
          5min
          2min
          1min
          30sec
Log       Start
          Stop
          Delete
  
```

## DATA LOGGING (Optional)

### Setup

Select Data Logging from Menu Selections.

- |             |  |
|-------------|--|
| Log Site ID | Enter a number from 00 to 99. The site ID will become part of the downloaded file name to help distinguish downloads from different instruments. Press ✓ to store the setting. |
| Mode        | Select Level, Range, Flow, HRT and Volume . Flow (e.g. USGPM or l/sec). Press ✓ to store the setting.  |
| Set Date    | Press ↑ or ↓ to scroll and select Month, Day and Year. Press ✓ to store the setting.   |
| Set Time    | Press ↑ or ↓ to select the current time in Hours, Minutes and Seconds. Press ✓ to store the setting.   |
| Interval    | Press ↑ or ↓ to select the logging interval. Flow rate reading will be stored at each time interval. Press ✓ to store the setting.   |
|             | Note: Press ↓ to Log ➡ and ↑ or ↓ to Delete and ✓ to delete the log file. Press ➡ and ↑ or ↓ to Start and ✓ to restart the logger.   |
| Log         | Stop, Start or Delete the log file. Delete old file and start a new log to apply any changes that have been made to the Log Site ID, Mode or Interval.                         |

## RETRIEVE LOG FILE

Plug a USB Flash Memory Drive (not supplied by Greyline) into the USB output cable from the instrument. The instrument display will show the message **Downloading** until the log file is transferred to the memory card and then display **Completed**. The USB flash drive may be removed.

Download file names will appear in this format:

```

      SLT_ _00A.LOG
      ↑   ↑  ↑
MODEL TAG DOWNLOAD
  
```

Tag is set according to the Log Site ID entered in the instrument Data Logging menu.

Download letter will be A for the first download from an instrument. B for the second, then C etc. At the letter Z a - character will appear indicating that the maximum number of downloads for that instrument are on the USB flash drive. Older files can be erased or moved from the flash memory drive or a new memory drive can be used.

### ***OPENING LOG FILES***

Install Greyline Logger on your PC or laptop. Refer to the Help menu in the program for detailed instructions.

Select File/Open/Instrument Log (.log) to open the log file from your USB flash drive.

CONVERSION GUIDE		
FROM	TO	MULTIPLY BY
US GALLONS	CUBIC FEET	0.1337
US GALLONS	IMPERIAL GALS	0.8327
US GALLONS	LITRES	3.785
US GALLONS	CUBIC METERS	0.003785
LITRES/SEC	GPM	15.85
LITRES	CUBIC METERS	0.001
BARRELS	US GALLONS	42
BARRELS	IMPERIAL GALS	34.9726
BARRELS	LITRES	158.9886
INCHES	MM	25.4
DEGREES F	DEGREES C	(°F-32) x 0.556
POUNDS	KILOGRAMS	0.453
PSI	BAR	0.0676
FOOT <sup>2</sup>	METER <sup>2</sup>	0.0929


VOLUME CALCULATION FOR ROUND TANKS:  $3.142 \times R^2 \times H$

R = TANK RADIUS (½ TANK DIAMETER)

H = TANK HEIGHT


### SPECIFICATIONS

<b>Accuracy:</b>	±0.25% of Range or 2 mm, whichever is greater
<b>Displays:</b>	White, backlit matrix - displays flow rate, totalizer, relay states, operating mode and calibration menu
<b>Calibration:</b>	built-in 5-key calibrator with English, French or Spanish language selection
<b>Power Input:</b>	100-240Vac, 50/60Hz, 30 Watts or 115Vac, 50/60Hz, 30 Watts or 230Vac, 50/60Hz, 30 Watts or 9-32Vdc, 9 Watts max
<b>Output:</b>	Isolated 4-20mA (1000 ohm load max.)
<b>Control Relays:</b>	Qty 2, rated 5 amp 240Vac SPDT, programmable flow alarm and/or proportional pulse
<b>Enclosure:</b>	watertight, dust tight NEMA4X (IP66) fiberglass with a clear shatter-proof face
<b>Environmental Conditions:</b>	Relative humidity up to 80% -23 to 60°C ambient temperature, maximum 5000 m altitude, pollution degree 4, Installation Category II.
<b>Sensitivity:</b>	adjustable. Damping: adjustable
<b>Electrical Surge Protection:</b>	Sensor, 4-20mA output and AC power input
<b>Shipping Weight:</b>	14 lbs (6.3 kg)

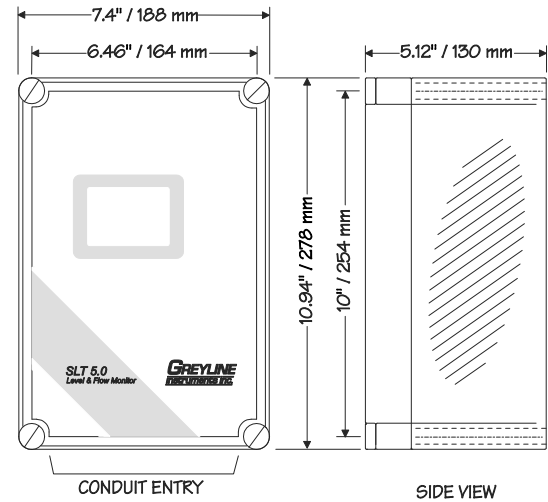

### Standard Sensor PZ32T


<b>Maximum Range:</b>	32 ft. (10 m)
<b>Deadband (blanking):</b>	Programmable, minimum 12" (305 mm)
<b>Beam Angle:</b>	8° at 3 DB
<b>Temperature Compensation:</b>	Automatic, continuous
<b>Operating Frequency:</b>	42 KHz
<b>Exposed Materials:</b>	PVC and Teflon
<b>Operating Temperature:</b>	- 40° to 150°F (-40° to 65°C)
<b>Operating Pressure:</b>	20 psi (1.35 Bar) maximum
<b>Mounting:</b>	¾" NPT (PVC isolation coupling supplied)
<b>Sensor Cable:</b>	RG62AU coaxial, 25 ft. (7.6 m) standard
<b>Hazardous Rating:</b>	with optional Intrinsic Safety Barrier: CSA, Class I,II,III, Div. I,II, Groups C,D,E,F,G Note: Max Range reduced to 25 ft (7.6 m) with ISB option.

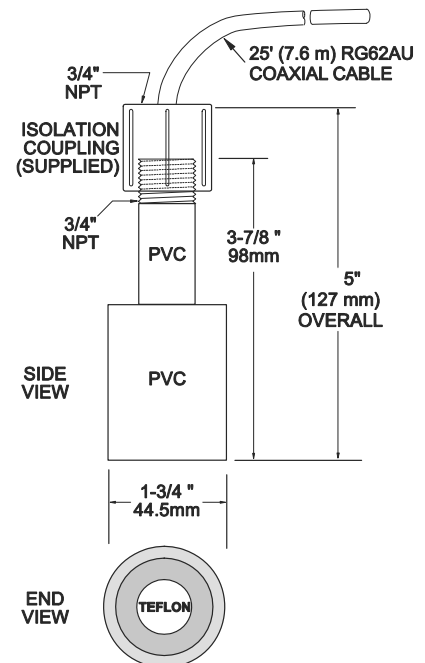




### Optional Sensor PZ32TE

<b>Maximum Range:</b>	32 ft. (10 m)
<b>Deadband (blanking):</b>	Programmable, minimum 12" (305 mm)
<b>Beam Angle:</b>	8° at 3 DB
<b>Temperature Compensation:</b>	Automatic, continuous
<b>Operating Frequency:</b>	42 KHz
<b>Exposed Materials:</b>	Teflon
<b>Operating Temperature:</b>	-40° to 170°F (-40° to 76°C)
<b>Operating Pressure:</b>	20 psi (1.35 Bar) maximum
<b>Mounting:</b>	3/4" NPT (Teflon isolation coupling supplied)
<b>Sensor Cable:</b>	RG62AU coaxial, 25 ft. (7.6 m) standard
<b>Hazardous Rating:</b>	with optional Intrinsic Safety Barrier: CSA, Class I,II,III, Div. I,II, Groups C,D,E,F,G, Note: Max Range reduced to 25 ft (7.6 m) with ISB option.

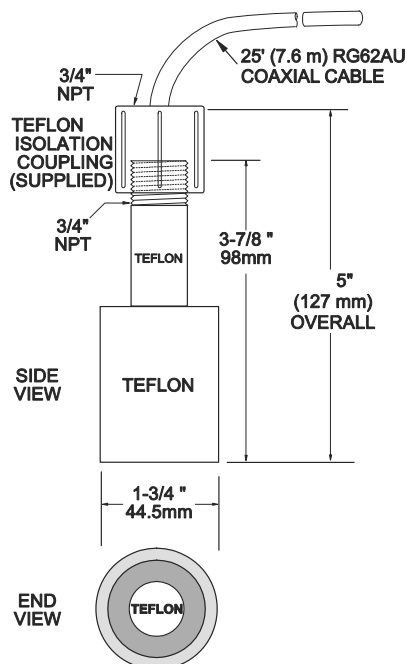


### Optional PZ15

<b>Maximum Range:</b>	15 ft (4.57 m)
<b>Minimum Range (Deadband):</b>	8" (203.2 mm)
<b>Operating Frequency:</b>	92 KHz
<b>Beam Angle:</b>	8°
<b>Operating Temperature:</b>	-40° to 150° (-40° to 65°C)
<b>Temperature Compensation:</b>	Automatic, continuous
<b>Max. Operating Pressure:</b>	20 psi (1.35 bar)
<b>Sensor Face:</b>	PVC
<b>Sensor Body:</b>	PVC
<b>Mounting:</b>	3/4" NPT
<b>Cable Length:</b>	25 ft. (7.6 m) continuous RG62AU coaxial. Optional 50 ft. (15 m) continuous
<b>Max. Cable Length:</b>	500 ft. (152 m) RG62AU coaxial (splice)
<b>Hazardous Rating:</b>	CSA rated Intrinsically Safe Class I, Groups C,D, Class II, Groups E,F,G with Optional Intrinsic Safety Barrier.

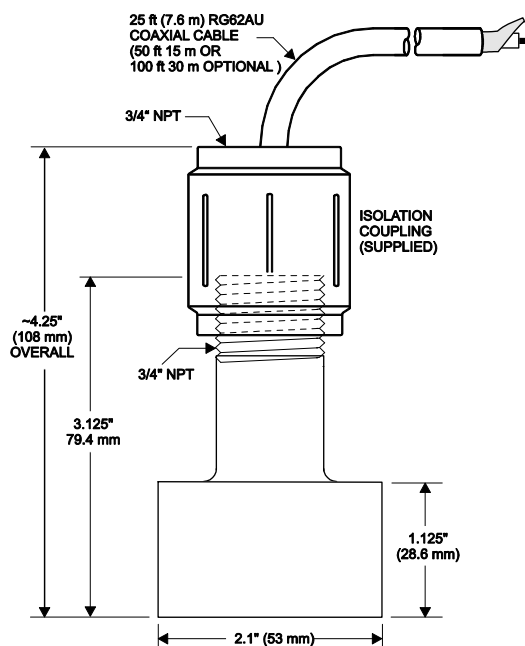


## Optional PZ12T\_F

<b>Maximum Range:</b>	12 ft (3.66 m)
<b>Minimum Range (Deadband):</b>	8" (203.2 mm)
<b>Operating Frequency:</b>	92 KHz
<b>Beam Angle:</b>	8°
<b>Operating Temperature:</b>	-40° to 150° (-40° to 65°C)
<b>Temperature Compensation:</b>	Automatic, continuous
<b>Max. Operating Pressure:</b>	20 psi (1.35 bar)
<b>Sensor Face:</b>	Teflon
<b>Sensor Body:</b>	PVC
<b>Mounting:</b>	¾" NPT
<b>Cable Length:</b>	25 ft. (7.6 m) continuous RG62AU coaxial. Optional 50 ft. (15 m) continuous
<b>Max. Cable Length:</b>	500 ft. (152 m) RG62AU coaxial (splice)
<b>Hazardous Rating:</b>	CSA rated Intrinsically Safe Class I, Groups C,D, Class II, Groups E,F,G with optional Intrinsic Safety Barrier.

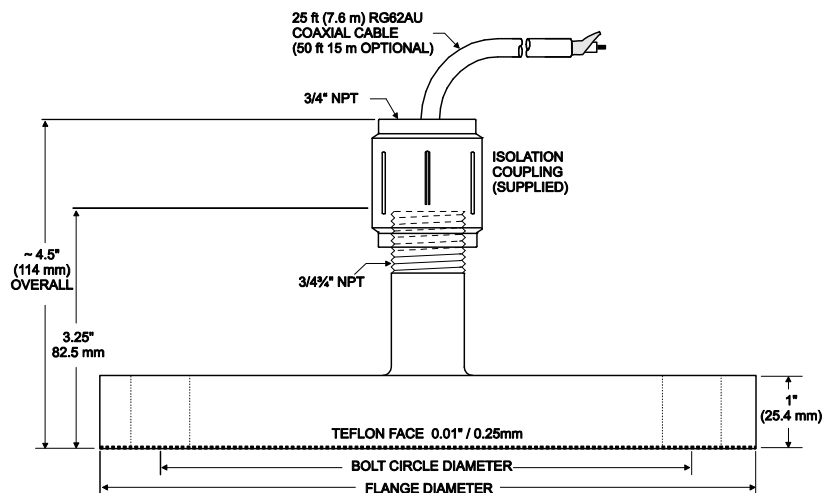

## Optional PZ34

**Maximum Range:** 32 ft. (10 m)  
**Minimum Range (Deadband):** 16" (406.4 mm)  
**Operating Frequency:** 46 KHz  
**Beam Angle:** 8°  
**Temperature Compensation:** Automatic, continuous  
**Operating Temperature:** -40° to 150°F (-40° to 65°C)  
**Maximum Operating Pressure:** 20 psi (1.35 Bar)  
**Exposed Materials:** PVC  
**Sensor Mounting:** 3/4" NPT  
**Maximum Cable Length:** 500 ft (152 m)  
**Optional Hazardous Rating:** CSA rated Intrinsically Safe Class I, Groups C,D, Class II, Groups E,F,G with optional Intrinsic Safety Barrier.  
 Note: Max Range reduced to 25 ft (7.8 m) with ISB option.

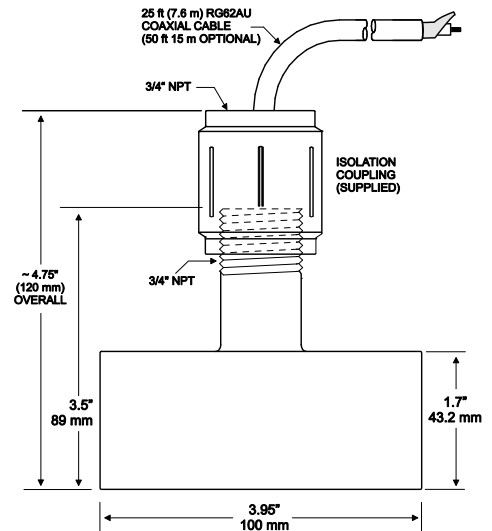

## Optional PZ34T\_F

**Maximum Range:** 32 ft. (10 m)  
**Minimum Range (Deadband):** 16" (406.4 mm)  
**Operating Frequency:** 46 KHz  
**Beam Angle:** 8°  
**Temperature Compensation:** Automatic, continuous  
**Operating Temperature:** -40° to 150°F (-40° to 65°C)  
**Maximum Operating Pressure:** 20 psi (1.35 Bar)  
**Sensor Face:** Teflon  
**Sensor Body:** PVC (not exposed to tank contents)  
**Cable Length:** 25 ft. (7.8 m) continuous RG62AU coaxial Optional 50 ft. (15 m) continuous  
**Maximum Cable Length:** 500 ft (152 m) RG62AU coaxial (splice)  
**Hazardous Rating:** CSA rated Intrinsically Safe Class I, Groups C,D, Class II, Groups E,F,G with optional Intrinsic Safety Barrier.

